

[00775644]

HNF-EP-0182  
Revision 337


# Waste Tank Summary Report for Month Ending January 31, 2016

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-08RV14800



P.O. Box 850  
Richland, Washington

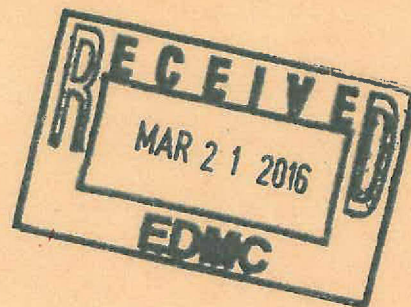

<b>DOCUMENT RELEASE AND CHANGE FORM</b>		1a. Doc No: HNF-EP-0182    Rev. 337																																								
Prepared For the U.S. Department of Energy, Assistant Secretary for Environmental Management By Washington River Protection Solutions, LLC., PO Box 850, Richland, WA 99352 Contractor For U.S. Department of Energy, Office of River Protection, under Contract DE-AC27-08RV14800		1b. Project Number: <input checked="" type="checkbox"/> N/A																																								
TRADEMARK DISCLAIMER: Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States government or any agency thereof or its contractors or subcontractors.  Printed in the United States of America.		<div style="border: 2px solid red; padding: 10px; width: fit-content; margin: auto;"> <p style="margin: 0;">Release Stamp</p> <p style="font-size: 1.2em; color: red; margin: 5px 0;"><b>DATE:</b></p> <p style="font-size: 1.2em; color: red; margin: 0;">Mar 10, 2016</p> </div>																																								
2. Document Title Waste Tank Summary Report for Month Ending January 31, 2016																																										
3. Design Verification Required <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No																																										
4. USQ Number <input checked="" type="checkbox"/> N/A NA	5. PrHA Number <input checked="" type="checkbox"/> N/A Rev.																																									
6. USQ Screening: <div style="margin-left: 20px;">             a. Does the change introduce any new failure modes to the equipment?    <input type="checkbox"/> Yes    <input checked="" type="checkbox"/> No              Basis is required for Yes: _____           </div> <div style="margin-left: 20px;">             b. Does the change increase the probability of existing failure modes?    <input type="checkbox"/> Yes    <input checked="" type="checkbox"/> No              Basis is required for Yes: _____           </div> <div style="margin-left: 20px;">             c. For Safety Significant equipment, does the change require a modification to Chapter 4 of the DSA and/or FRED?    <input type="checkbox"/> Yes    <input type="checkbox"/> No    <input checked="" type="checkbox"/> N/A              Basis is required for Yes: _____           </div>																																										
7. Description of Change and Justification (Use Continuation pages as needed) <div style="margin-left: 20px; padding-top: 10px;">             Complete Revision – Tables and text updated each month to reflect revised status.               DOE-ORP requires this document to be revised and issued monthly.               No USQ review required as this document is listed in RPP-27195 as outside the scope of the USQ process.           </div>																																										
8. Approvals <table border="1" style="width: 100%; border-collapse: collapse; margin-top: 5px;"> <thead> <tr> <th style="width: 35%;">Title</th> <th style="width: 30%;">Name</th> <th style="width: 30%;">Signature</th> <th style="width: 5%;">Date</th> </tr> </thead> <tbody> <tr> <td>Clearance Review</td> <td>WASHINGTON, MARGUERITE</td> <td>WASHINGTON, MARGUERITE</td> <td>03/10/2016</td> </tr> <tr> <td>Document Control Approval</td> <td>WASHINGTON, MARGUERITE</td> <td>WASHINGTON, MARGUERITE</td> <td>03/10/2016</td> </tr> <tr> <td>Originator</td> <td>TEMPLETON, ANDREW M</td> <td>TEMPLETON, ANDREW M</td> <td>03/09/2016</td> </tr> <tr> <td>Other Approver</td> <td>SCHOFIELD, JOHN</td> <td>SCHOFIELD, JOHN</td> <td>03/10/2016</td> </tr> <tr> <td>Other Approver</td> <td>RODGERS, MATT J</td> <td>RODGERS, MATT J</td> <td>03/09/2016</td> </tr> <tr> <td>Responsible Manager</td> <td>BAUNE, HEATHER L</td> <td>BAUNE, HEATHER L</td> <td>03/10/2016</td> </tr> <tr><td> </td><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td><td> </td></tr> <tr><td> </td><td> </td><td> </td><td> </td></tr> </tbody> </table>			Title	Name	Signature	Date	Clearance Review	WASHINGTON, MARGUERITE	WASHINGTON, MARGUERITE	03/10/2016	Document Control Approval	WASHINGTON, MARGUERITE	WASHINGTON, MARGUERITE	03/10/2016	Originator	TEMPLETON, ANDREW M	TEMPLETON, ANDREW M	03/09/2016	Other Approver	SCHOFIELD, JOHN	SCHOFIELD, JOHN	03/10/2016	Other Approver	RODGERS, MATT J	RODGERS, MATT J	03/09/2016	Responsible Manager	BAUNE, HEATHER L	BAUNE, HEATHER L	03/10/2016												
Title	Name	Signature	Date																																							
Clearance Review	WASHINGTON, MARGUERITE	WASHINGTON, MARGUERITE	03/10/2016																																							
Document Control Approval	WASHINGTON, MARGUERITE	WASHINGTON, MARGUERITE	03/10/2016																																							
Originator	TEMPLETON, ANDREW M	TEMPLETON, ANDREW M	03/09/2016																																							
Other Approver	SCHOFIELD, JOHN	SCHOFIELD, JOHN	03/10/2016																																							
Other Approver	RODGERS, MATT J	RODGERS, MATT J	03/09/2016																																							
Responsible Manager	BAUNE, HEATHER L	BAUNE, HEATHER L	03/10/2016																																							
9. Clearance Review: <div style="margin-left: 20px; padding-top: 5px;"> <b>Restriction Type:</b> <div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%;"> <input checked="" type="checkbox"/> Public  <input type="checkbox"/> Undefined  <input type="checkbox"/> Unclassified Controlled Nuclear Information (UCNI)  <input type="checkbox"/> Export Control Information (ECI)  <input type="checkbox"/> Official Use Only Exemption 2-Circumvention of Statute (OUO-2)             </div> <div style="width: 50%;"> <input type="checkbox"/> Official Use Only Exemption 3-Statutory Exemption (OUO-3)  <input type="checkbox"/> Official Use Only Exemption 4-Commercial/Proprietary (OUO-4)  <input type="checkbox"/> Official Use Only Exemption 5-Privileged Information (OUO-5)  <input type="checkbox"/> Official Use Only Exemption 6-Personal Privacy (OUO-6)  <input type="checkbox"/> Official Use Only Exemption 7-Law Enforcement (OUO-7)             </div> </div> </div>																																										



<b>DOCUMENT RELEASE AND CHANGE FORM</b>			<b>Doc No:</b> HNF-EP-0182 <b>Rev.</b> 337
<b>10. Distribution:</b>			
<b>Name</b>	<b>Organization</b>		
ANDERSON, MASON A	TNK WST INVENTORY & CHARACTZTN		
BAUNE, HEATHER L	222S LABORATORY ENGINEERING		
CRAWFORD, JORDAN T	TNK WST INVENTORY & CHARACTZTN		
DETRICH, ELIZABETH J	TNK WST INVENTORY & CHARACTZTN		
FERRITER, SEAN D	TNK WST INVENTORY & CHARACTZTN		
KADINGER, JENNIFER A	TNK WST INVENTORY & CHARACTZTN		
LUKE, SCOTT N	TNK WST INVENTORY & CHARACTZTN		
NGUYEN, DUC M	TNK WST INVENTORY & CHARACTZTN		
RASMUSSEN, JUERGEN H	TNK WST INVENTORY & CHARACTZTN		
RODGERS, MATT J	TNK WST INVENTORY & CHARACTZTN		
SAMS, TERRY L	PROCESS ENGINEERING ANALYSIS		
STURMAN, GRANT A	TNK WST INVENTORY & CHARACTZTN		
TEMPLETON, ANDREW M	TNK WST INVENTORY & CHARACTZTN		
<b>11. TBDs or Holds</b> <span style="float: right;"><input checked="" type="checkbox"/> N/A</span>			
<b>12. Impacted Documents – Engineering</b> <span style="float: right;"><input checked="" type="checkbox"/> N/A</span>			
<b>Document Number</b>	<b>Rev.</b>	<b>Title</b>	
<b>13. Other Related Documents</b> <span style="float: right;"><input checked="" type="checkbox"/> N/A</span>			
<b>Document Number</b>	<b>Rev.</b>	<b>Title</b>	
<b>14. Related Systems, Structures, and Components:</b>			
<b>14a. Related Building/Facilities</b> <span style="float: right;"><input checked="" type="checkbox"/> N/A</span>	<b>14b. Related Systems</b> <span style="float: right;"><input checked="" type="checkbox"/> N/A</span>	<b>14c. Related Equipment ID Nos. (EIN)</b> <span style="float: right;"><input checked="" type="checkbox"/> N/A</span>	

**DOCUMENT RELEASE AND CHANGE FORM  
CONTINUATION SHEET****Document No:** HNF-EP-0182 **Rev.** 337

N/A



HNF-EP-0182, Rev. 337

## WASTE TANK SUMMARY REPORT FOR MONTH ENDING JANUARY 31, 2016

A. M. Templeton

WASHINGTON RIVER PROTECTION SOLUTIONS  
Richland, WA 99352  
U.S. Department of Energy Contract DE-AC27-08RV14800

EDT/ECN:	DRCF	UC:	N/A
Cost Center:	2KL00	Charge Code:	202352
B&R Code:	N/A	Total Pages:	66

Key Words: MONTHLY REPORT, WASTE TANK SUMMARY, DST, SST

**Abstract:** This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report is intended to meet the requirement of DOE O 435.1, Radioactive Waste Management, requiring the reporting of tank waste inventories and space utilization for the Hanford Site tank farms.

---

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

**APPROVED***By marguerite washington at 2:25 pm, Mar 10, 2016*

Release Approval

Date

**DATE:****Mar 10, 2016****HANFORD  
RELEASE**

Release Stamp

**Approved For Public Release**

HNF-EP-0182  
Revision 337

### RECORD OF REVISION

Date	Revision	Description	Changed by
1/24/2001	153	EDT-631372	B. M. Hanlon
Record of revision truncated for brevity			
9/15/2014	318	Incorporation of DRF (Full Revision)	M. J. Rodgers
9/25/2014	319	Complete revision	D. I. Weyns
10/27/2014	320	Complete revision	D. I. Weyns
11/12/2014	321	Complete revision	D. I. Weyns
12/17/2014	322	Complete revision	D. I. Weyns
1/13/2015	323	Complete revision	D. I. Weyns
2/11/2015	324	Complete revision	M. J. Rodgers
3/12/2015	325	Complete revision	M. J. Rodgers
4/9/2015	326	Complete revision	M. J. Rodgers
5/7/2015	327	Complete revision	M. J. Rodgers
6/9/2015	328	Complete revision	M. J. Rodgers
7/13/2015	329	Complete revision	M. J. Rodgers
8/11/2015	330	Complete revision	A. M. Templeton
9/9/2015	331	Complete revision	A. M. Templeton
10/7/2015	332	Complete revision	A. M. Templeton
11/9/2015	333	Complete revision	A. M. Templeton
12/2/2015	334	Complete revision	A. M. Templeton
1/14/2016	335	Complete revision	A. M. Templeton
2/9/2016	336	Complete revision	A. M. Templeton
3/10/2016	<b>RS</b> 337	Complete revision	A. M. Templeton



HNF-EP-0182  
Revision 337

# Waste Tank Summary Report for Month Ending January 31, 2016

**A. M. Templeton**  
Washington River Protection Solutions, LLC

Date Published  
March 2016

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC27-08RV14800



**P.O. Box 850**  
**Richland, Washington**

Approved for Public Release; Further Dissemination Unlimited

HNF-EP-0182  
Revision 337

**TRADEMARK DISCLAIMER**

Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

This report has been reproduced from the best available copy.  
Available in paper copy.

Printed in the United States of America



**CONTENTS**

1.0	PURPOSE AND SCOPE .....	1
1.1	Description of Table 1-1 Changes from Last Report .....	2
2.0	SINGLE-SHELL TANKS WASTE RETRIEVAL STATUS HIGHLIGHTS .....	9
3.0	DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES.....	11
4.0	SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES.....	15
4.1	Leak Volume Estimates .....	21
4.2	Water Intrusion in Single-Shell Tanks .....	24
5.0	MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES .....	27
6.0	ENDNOTES AND REFERENCES .....	33
6.1	Report Endnotes .....	33
6.2	References .....	41

**APPENDIX**

Appendix A – Glossary.....	A-1
----------------------------	-----

**FIGURES**

Figure 1-1.	Double-Shell Tank Configuration.....	3
Figure 1-2.	Single-Shell Tank Configuration .....	3
Figure 1-3.	200 East Area Tank Waste Contents .....	5
Figure 1-4.	200 West Area Tank Waste Contents .....	7

**TABLES**

Table 1-1.	Waste Tank Summary – January 31, 2016 .....	2
Table 2-1.	Single-Shell Tanks in Retrieval Status .....	9
Table 3-1.	Inventory and Status by Tanks – Double-Shell Tanks (2 pages).....	11
Table 3-2.	Double-Shell Tank Space Allocation, Inventory and Waste Receipts .....	13
Table 4-1.	Inventory and Status by Tanks – Single-Shell Tanks (6 pages) .....	15
Table 4-2.	Tank Leak Volume Estimates (3 pages) .....	21
Table 4-3.	Single-Shell Tanks with Confirmed Water Intrusion .....	24
Table 4-4.	Single-Shell Tanks with Evidence of Recent Water Intrusion .....	25
Table 5-1.	200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages) .....	27
Table 5-2.	200 West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages) .....	30
Table 6-1.	Waste Tank Summary Report Endnotes (8 pages) .....	33



**TERMS****Acronyms**

DCRT	double-contained receiver tank
DOE	U.S. Department of Energy
DST	double-shell tank
Ecology	State of Washington, Department of Ecology
HEPA	high-efficiency particulate air
HVAC	heating, ventilation, and air conditioning
MUST	miscellaneous underground storage tank
ORP	U.S. Department of Energy, Office of River Protection
OSD	operating specifications document
PUREX	plutonium/uranium extraction
RECUPLEX	recovery of uranium and plutonium by extraction
REDOX	reduction-oxidation
SST	single-shell tank
TWINS	Tank Waste Information Network System
WAC	Washington Administrative Code
WRPS	Washington River Protection Solutions LLC
WTP	Waste Treatment and Immobilization Plant
WVR	waste volume reduction

**Units**

ft	feet
gal	gallon
in.	inch
kgal	thousand gallons
Mgal	million gallons
min	minute
mo	month

This page intentionally left blank.

HNF-EP-0182  
Revision 337

## 1.0 PURPOSE AND SCOPE

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and smaller miscellaneous underground storage tanks (MUST) and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of DOE O 435.1, *Radioactive Waste Management*, requiring the reporting of tank waste inventories and space utilization for the Hanford Site tank farms.

Throughout this report, individual tanks and tank farms are referred to without the "241" preceding the tank/tank farm designator (e.g., Tank 241-C-102 is referred to as Tank C-102, and 241-A Tank Farm is referred to as A Farm).

Revision 322 of this document incorporated changes to the format and content of the entire report. In addition, a full reference section was added in Section 6.2 and the glossary was moved to Appendix A.

HNF-EP-0182  
Revision 337**1.1 DESCRIPTION OF TABLE 1-1 CHANGES FROM LAST REPORT**

Table 1-1 summarizes the DST and SST information available in subsequent detailed tables, and identifies changes in tank and waste status that have occurred during the report period. All table endnotes are included in Section 6.1.

**Table 1-1. Waste Tank Summary – January 31, 2016**

	Sound DSTs			DSTs with Primary Tank Leak <sup>(1)</sup>			DSTs with Secondary Tank Leak		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	27	27	27	1	1	1	0	0	0
Double-shell tanks	DST Storage Capacity (Mgal)			Waste Stored in DSTs (Mgal)			Available DST Storage Space (Mgal)		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	32.3	32.5	32.5	26.6	25.8	25.8	3.2	4.2	4.1
Single-shell tanks	Sound SSTs			Assumed Leaker SSTs			SSTs with Known Active Leaks		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	88	88	88	61	61	61	1	1	1
	SSTs in Level Increase Evaluation <sup>(2)</sup>			SSTs in Level Decrease Evaluation <sup>(3)</sup>			SSTs in Formal Leak Assessment		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	10	0	0	0	0	0	1	1	1
	Total Waste Stored in SSTs (Mgal)			SSTs in Retrieval <sup>(4)</sup>			SSTs with Intrusions		
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current
	28.8	28.6	28.6	3	2	2	15	15	16
	Retrieval Operations Complete <sup>(5)</sup>			Retrieval Operations Complete and in Review <sup>(6)</sup>					
	1 year ago	1 mo. ago	Current	1 year ago	1 mo. ago	Current			
	13	14	14	1	1	1			

DST = double-shell tank.

SST = single-shell tank.

Changes in the tank waste summaries listed in Table 1-1 from the previous revision of this report are summarized below.


- Retrieval of C-111 using caustic dissolution continued in January. Approximately 17,000 gallons of water was added to C-111, 21,000 gallons of waste was transferred to AN-101 and approximately 17,000 gallons of caustic was added to C-111. By the end of January the caustic had been re-circulated for approximately 136 hours.
- Intrusion was observed in tank T-107 during a 1/4/16 video inspection.




HNF-EP-0182  
Revision 337

Illustrations of the double-shell tank (DST) and single-shell tank (SST) configurations are shown in Figure 1-1 and Figure 1-2, respectively. Figure 1-3 and Figure 1-4 summarize the 200 East Area and 200 West Area tank contents by tank farm.

**Figure 1-1. Double-Shell Tank Configuration**

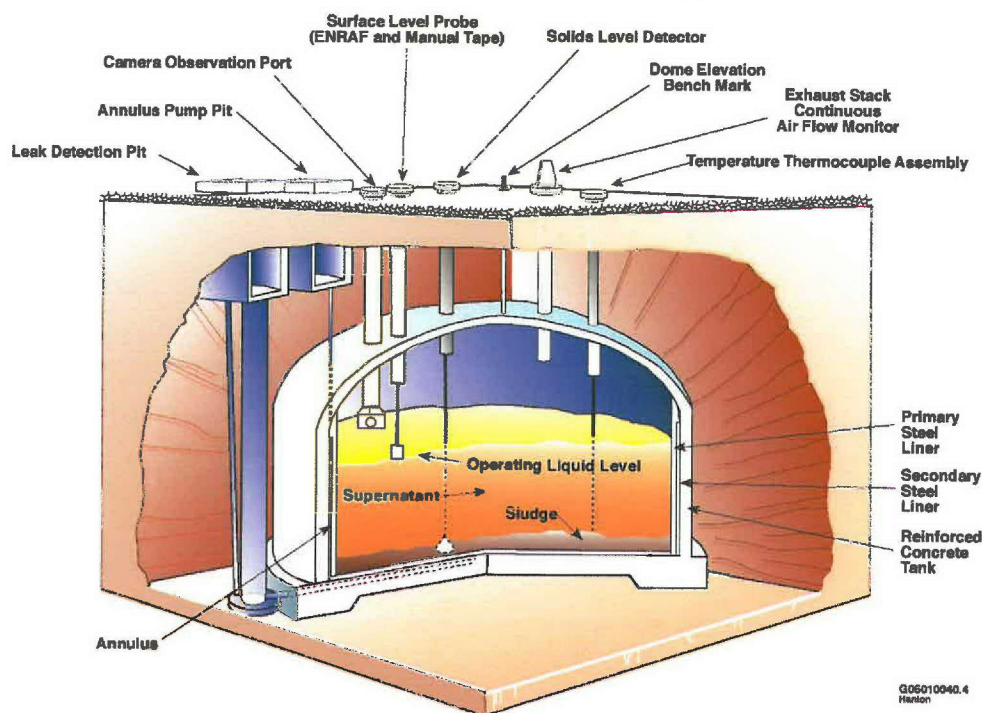

**Figure 1-2. Single-Shell Tank Configuration**

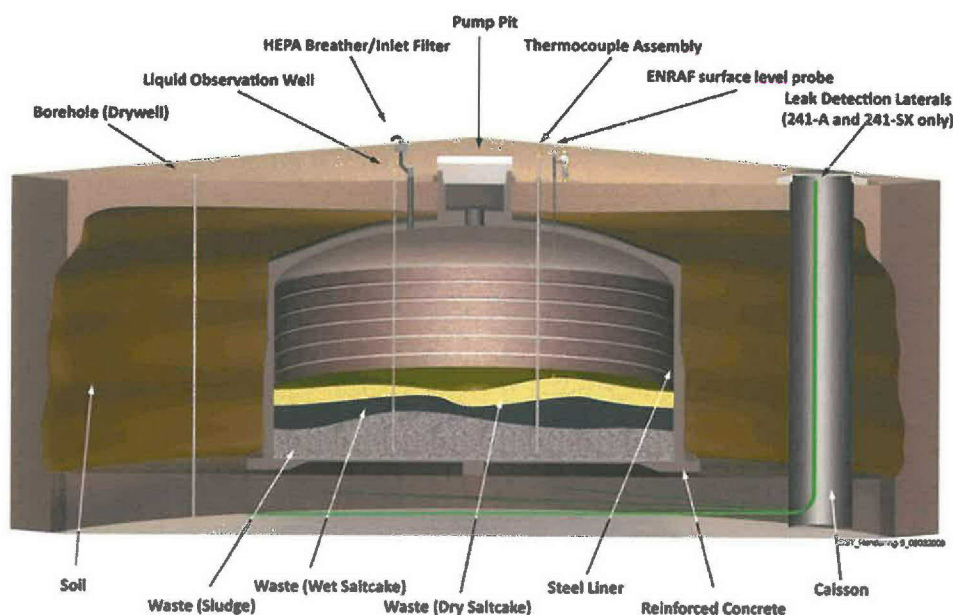

HNF-EP-0182  
Revision 337


This page intentionally left blank.



Figure 1-3. 200-East Tank Waste Contents


A-Tank Farm- Constructed 1953-1955  
6 @ 1,000 Kgal Tank Capacity, Single-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-A-101	3	317	0
241-A-102	0	38	2
241-A-103	2	372	9
241-A-104	25	0	0
241-A-105	37	0	0
241-A-106	50	29	0

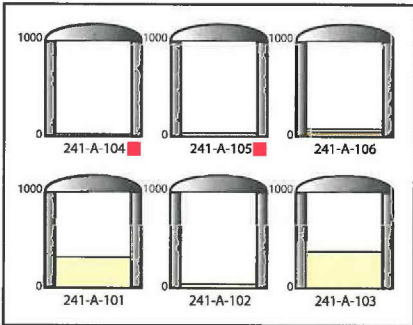


AN-Tank Farm- Constructed 1977-1980  
7 @ 1,160 Kgal Tank Capacity, Double-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-AN-101	741	30	255
241-AN-102	0	154	901
241-AN-103	0	491	470
241-AN-104	0	445	605
241-AN-105	0	538	584
241-AN-106	483	17	257
241-AN-107	0	240	831

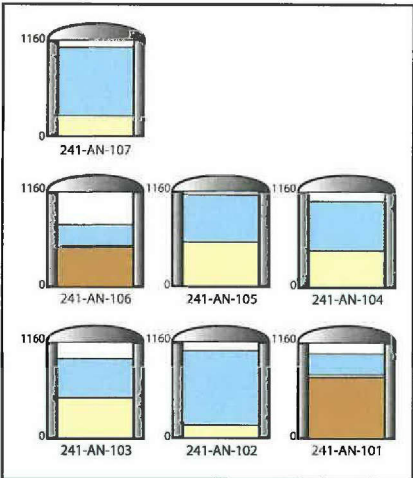


AP-Tank Farm- Constructed 1982-1986  
2 @ 1,160 Kgal Tank Capacity, Double-Shell  
6 @ 1,257 Kgal Tank Capacity, Double-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-AP-101	0	33	1200
241-AP-102	28	0	1111
241-AP-103	0	16	860
241-AP-104	0	99	1143
241-AP-105	0	105	1137
241-AP-106	0	0	1126
241-AP-107	0	63	993
241-AP-108	0	112	1128

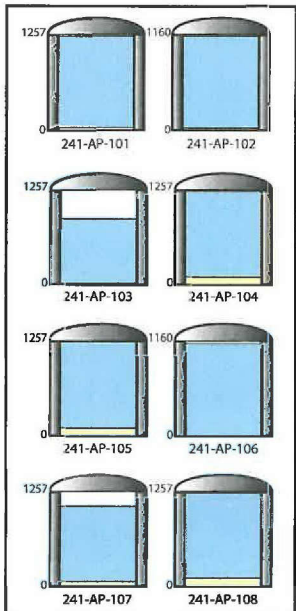


AW-Tank Farm- Constructed 1976-1980  
6 @ 1,160 Kgal Tank Capacity, Double-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-AW-101	0	396	739
241-AW-102	52	0	58
241-AW-103	280	40	757
241-AW-104	97	157	796
241-AW-105	248	0	149
241-AW-106	0	264	865

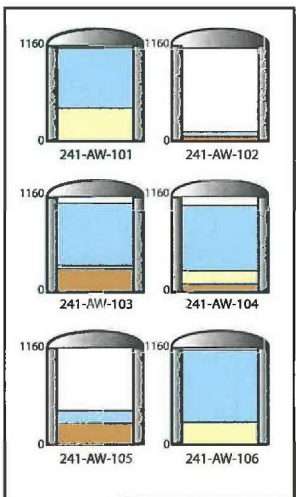


AX-Tank Farm- Constructed 1963-1965  
4 @ 1,000 Kgal Tank Capacity, Single-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-AX-101	3	355	0
241-AX-102	6	24	0
241-AX-103	8	99	0
241-AX-104	5	0	0

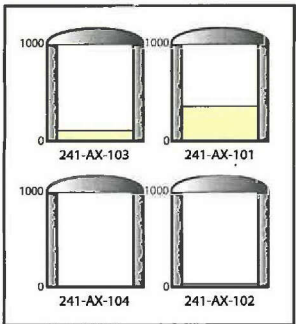


AY-Tank Farm- Constructed 1968-1970  
2 @ 1,018 Kgal Tank Capacity, Double-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-AY-101	105	0	507
241-AY-102	151	0	595

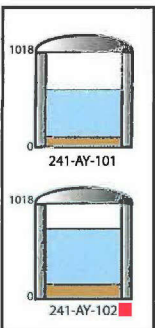


AZ-Tank Farm- Constructed 1970-1974  
2 @ 1,018 Kgal Tank Capacity, Double-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-AZ-101	52	0	728
241-AZ-102	105	0	79

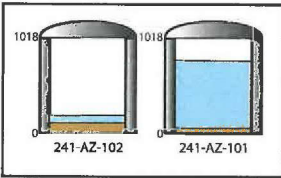


B-Tank Farm- Constructed 1943-1944  
12 @ 530 Kgal Tank Capacity, Single-Shell  
4 @ 55 Kgal Tank Capacity, Single-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-B-101	28	81	0
241-B-102	0	28	4
241-B-103	1	55	0
241-B-104	309	65	0
241-B-105	28	262	0
241-B-106	122	0	1
241-B-107	86	75	0
241-B-108	27	65	0
241-B-109	50	71	1
241-B-110	244	0	1
241-B-111	241	0	1
241-B-112	15	17	3
241-B-201	29	0	0
241-B-202	27	0	2
241-B-203	49	0	1
241-B-204	48	0	2

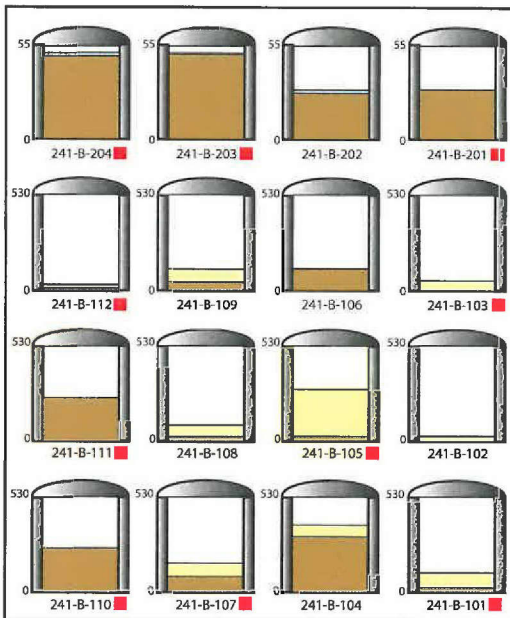


BX-Tank Farm- Constructed 1946-1947  
12 @ 530 Kgal Tank Capacity, Single-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-BX-101	48	0	5
241-BX-102	79	0	0
241-BX-103	62	0	15
241-BX-104	97	0	3
241-BX-105	42	25	5
241-BX-106	10	28	0
241-BX-107	347	0	0
241-BX-108	31	0	0
241-BX-109	193	0	0
241-BX-110	65	145	6
241-BX-111	30	94	0
241-BX-112	163	0	1

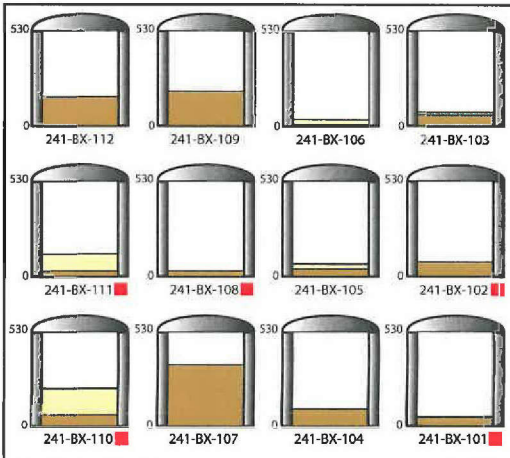


BY-Tank Farm- Constructed 1948-1949  
12 @ 758 Kgal Tank Capacity, Single-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-BY-101	37	333	0
241-BY-102	0	316	0
241-BY-103	9	408	0
241-BY-104	46	359	0
241-BY-105	48	433	0
241-BY-106	32	398	0
241-BY-107	15	256	0
241-BY-108	40	182	0
241-BY-109	24	263	0
241-BY-110	43	323	0
241-BY-111	0	402	0
241-BY-112	2	284	0

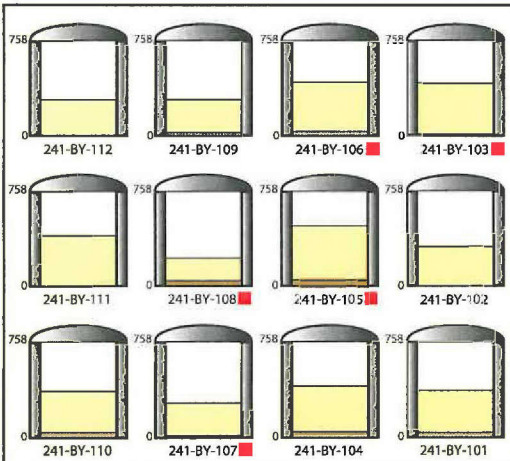

C-Tank Farm- Constructed 1943-1944  
12 @ 530 Kgal Tank Capacity, Single-Shell  
4 @ 55 Kgal Tank Capacity, Single-Shell

Kgal			
Tank	Sludge	Saltcake	Supernatant
241-C-101	6	0	0
241-C-102	15	0	0
241-C-103	2	0	0
241-C-104	2	0	0
241-C-105	67	0	7
241-C-106	3	0	0
241-C-107	10	0	0
241-C-108	3	0	0
241-C-109	2	0	0
241-C-110	2	0	0
241-C-111	18	0	20
241-C-112	10	0	0
241-C-201	0	0	0
241-C-202	0	0	0
241-C-203	0	0	0
241-C-204	0	0	0

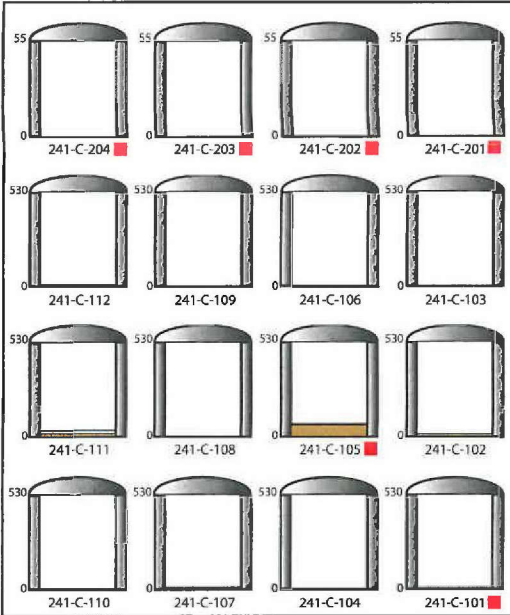

LEGEND

Sludge Saltcake Supernatant Available Space

Assumed/Confirmed Leaker

Data Derived From Waste Tank Summary Report Dated 1/31/2016

M. J. Rodgers  
washington river  
protection solutions

\\hmf\data\sitedata\CHARD\CS\All By Staff Member\Rodgers\Tank Figures\200 East Tank Profile 2016-01-31.pdf



Figure 1-4. 200-West Tank Waste Contents





HNF-EP-0182  
Revision 337**2.0 SINGLE-SHELL TANKS WASTE RETRIEVAL STATUS HIGHLIGHTS**

The waste retrieval status of the Hanford SSTs is summarized in Table 2-1.

**Table 2-1. Single-Shell Tanks in Retrieval Status**

<b>Tank (241-)</b>	<b>Status<sup>(5)</sup></b>	<b>Comments</b>	<b>Nominal Volume of Remaining Waste<sup>(8)</sup> (kgal)</b>	<b>Notes (see Section 6.1)</b>
C-101	Complete	Declared "Retrieved to Limit of First and Second Retrieval Technologies," 9/25/2013	5.5	(9)
C-102	Complete	Declared "Retrieved to Limit of First and Second Retrieval Technologies," 11/30/2015	15.48	(10)
C-103	Complete	Declared "Retrieval Completed," 8/23/2006	2.5	(11)
C-104	Complete	Declared "Retrieval Completed," 8/17/2012	1.8	(12)
C-105	Ongoing	Retrieval in progress – retrieval initiated 6/11/2014	73.8	(13)
C-106	Complete/ In Review	Declared "Retrieval Completed," 12/31/2003	2.8	(14)
C-107	Complete	Declared "Retrieved to Limit of Third Retrieval Technology," 9/30/2014	10.2	(15)
C-108	Complete	Declared "Retrieved to Limit of Modified Sluicing Technology," 3/22/2012	3.3	(16)
C-109	Complete	Declared "Retrieved to Limit of Modified Sluicing Technology," 9/12/2012	2.0	(17)
C-110	Complete	Declared "Retrieval Completed," 10/30/2013	1.8	(18)
C-111	Ongoing	Retrieval in progress – retrieval initiated 9/14/2010	38	(19)
C-112	Complete	Declared "Retrieval Completed," 5/29/2014	10.0	(20)
C-201	Complete	Declared "Retrieval Completed," 3/23/2006	0.14	(21)
C-202	Complete	Declared "Retrieval Completed," 8/11/2005	0.15	(22)
C-203	Complete	Declared "Retrieval Completed," 3/24/2005	0.14	(23)
C-204	Complete	Declared "Retrieval Completed," 12/11/2006	0.14	(24)
S-112	Complete	Declared "Retrieval Completed," 3/2/2007	2.4	(25)



HNF-EP-0182  
Revision 337

This page intentionally left blank.

HNF-EP-0182  
Revision 337

### 3.0 DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES

The DST waste inventory and tank status are summarized in Table 3-1. DST space allocation, inventory, and waste receipts are summarized in Table 3-2.

**Table 3-1. Inventory and Status by Tanks – Double-Shell Tanks (2 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Tank Level (in.)	Total Waste (kgal)	Available Space (kgal)	Waste volumes			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
AN Farm Status								
AN-101	Sound	373	1026	134	255	741	30	12/30/15
AN-102	Sound	384	1055	105	901	0	154	4/1/2015
AN-103	Sound	350	961	199	470	0	491	6/1/2015
AN-104	Sound	382	1050	110	605	0	445	6/1/2015
AN-105	Sound	408	1122	38	584	0	538	6/1/2015
AN-106	Sound	275	757	403	257	483	17	10/01/15
AN-107	Sound	390	1071	89	831	0	240	7/1/2015
7 tanks – Total			7042	1078	3903	1224	1915	
AP Farm Status								
AP-101	Sound	448	1233	24	1200	0	33	7/1/2015
AP-102	Sound	414	1139	21	1111	28	0	7/1/2007
AP-103	Sound	319	876	381	860	0	16	11/01/15
AP-104	Sound	452	1242	15	1143	0	99	10/01/15
AP-105	Sound	452	1242	15	1137	0	105	10/1/2007
AP-106	Sound	410	1126	34	1126	0	0	10/17/2002
AP-107	Sound	384	1056	201	993	0	63	11/01/15
AP-108	Sound	451	1240	17	1128	0	112	7/1/2008
8 tanks – Total			9154	708	8698	28	377	
AW Farm Status								
AW-101	Sound	413	1135	25	739	0	396	1/31/2003
AW-102	Sound	40	110	1050	58	52	0	10/1/2015
AW-103	Sound	392	1077	83	757	280	40	3/3/2009
AW-104	Sound	382	1050	110	796	97	157	5/01/2015
AW-105	Sound	144	397	763	149	248	0	3/3/2009
AW-106	Sound	411	1129	31	865	0	264	10/1/2011
6 tanks – Total			4898	2062	3364	677	857	

HNF-EP-0182  
Revision 337**Table 3-1. Inventory and Status by Tanks – Double-Shell Tanks (2 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Tank Level (in.)	Total Waste (kgal)	Available Space (kgal)	Waste volumes			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
AY Farm Status								
AY-101	Sound	223	612	406	507	105	0	10/1/2015
AY-102	Assumed leaker; primary tank	271	746	272	595	151	0	10/28/15
2 tanks – Total			1358	678	1102	256	0	
AZ Farm Status								
AZ-101	Sound	284	780	238	728	52	0	3/23/2015
AZ-102	Sound	67	184	834	79	105	0	10/01/15
2 tanks – Total			964	1072	807	157	0	
SY Farm Status								
SY-101	Sound	407	1118	42	863	0	255	4/1/2008
SY-102	Sound	200	551	609	352	199	0	10/1/2010
SY-103	Sound	266	732	428	375	0	357	6/1/2015
3 tanks – Total			2401	1079	1590	199	612	

**Notes:**

- 1 kgal differences are the result of computer rounding.
- Supernatant + sludge (includes liquid) + saltcake (includes liquid) = total waste.
- Available space volumes include restricted space.
- Tanks AN-103, AN-104, AN-105, AW-101, SY-101, and SY-103 contain retained gas in the saltcake.
- Solids volume update lists the last verified date when the sludge or saltcake volume in the tank changed or was measured for changes.



HNF-EP-0182  
Revision 337

**Table 3-2. Double-Shell Tank Space Allocation, Inventory and Waste Receipts**

Total DST Capacity (kgal)	Total DST Waste Inventory (kgal)		Allocation of Remaining DST Space (kgal)	
32,494	Inventory on 1/31/2016 =	25,817	Total DST capacity <sup>a,b</sup> =	32,494
	Inventory on 12/31/2015 =	25,791	Waste inventory =	-25,817
	Change =	26	Restricted usage space <sup>c</sup> =	-1,265
			Emergency space allocation <sup>d</sup> =	-1,265
			Available space =	4,146

<sup>a</sup> Assumes maximum authorized limits per OSD-T-151-00007, *Operating Specifications for the Double-Shell Storage Tanks*: AN, AW, SY Farm = 422 in., AP Farm = 422 in., except Tanks AP-101, AP-103, AP-104, AP-105, AP-107 and AP-108 = 458 in.; AY and AZ Farms = 370 in. Volumes at maximum authorized limit from RPP-CALC-33163, *Tank Waste Volume and Level Calculations in Dome Space for 241-AP Tank Farm Up to 460 Inches*, and RPP-13019, *Determination of Hanford Waste Tank Volumes*.

<sup>b</sup> Total DST capacity will be changed to reflect Tank AY-102 removal from service following retrieval of tank contents.

<sup>c</sup> Restricted space associated with flammable gas Waste Group A and tanks controlled for waste feed delivery per feed control list, HNF-SD-WM-OCD-015, *Tank Farms Waste Transfer Compatibility Program*. These tanks are Tanks AN-102, AN-103, AN-104, AN-105, AN-107, AW-101, AY-102, and SY-103.

<sup>d</sup> Includes 1,265 kgal emergency space allocation per HNF-3484, *Double-Shell Tank Emergency Pumping Guide*, and emergency WTP returns per 24950-WTP-ICD-MG-019, *ICD 19 – Interface Control Document for Waste Feed*.

Facility Generations (kgal)		Gains Associated With (kgal)		Reductions Associated With (kgal)	
Tank farms	6	AZ-301 condensate	4	242-A Evaporator WVR <sup>j</sup>	0
242-A Evaporator <sup>i</sup>	0	Instrumentation <sup>e</sup>	3	Instrumentation <sup>e</sup>	0
Tank C-111 retrieval	21	Miscellaneous <sup>f</sup>	3	Miscellaneous <sup>f</sup>	0
		Thermal expansion <sup>h</sup>	0	Waste evaporation	11
Total = 27		Total = 10		Total = 11	

DST Net Waste Inventory Change					
Date	Facility Generation (kgal)	Gains (kgal)	Reductions (kgal)	Net waste Volume Change (kgal)	Total DST Waste Inventory (kgal)
1/2016	27	10	11	26	25,817

<sup>e</sup> Adjustments due to instrumentation recalibrations and/or instrument flushing.

<sup>f</sup> Adjustments for gas retention and release from Waste Group A tanks.

<sup>g</sup> A negative value for a retrieval number indicates the net total of retrieval and pumping of supernatant liquid back into the SST for soak of hard-heel solids.

<sup>h</sup> Adjustments for thermal expansion of liquids inside tanks.

<sup>i</sup> Evaporator gains include additions of pump seal water, slurry, and condensate.

<sup>j</sup> 242-A Evaporator WVR is total (before flush) waste volume reduction for 242-A Evaporator.

DST = double-shell tank.

SST = single-shell tank.

WTP = Waste Treatment and Immobilization Plant.

WVR = waste volume reduction.

HNF-EP-0182  
Revision 337

This page intentionally left blank.



HNF-EP-0182  
Revision 337**4.0 SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES**

The SST waste inventory and tank status are summarized in Table 4-1.

**Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) <sup>a</sup>	Drainable Interstitial Liquid (kgal)	Waste Volumes <sup>(26)</sup>			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
A Farm Status								
A-101 <sup>(27)</sup>	Sound		320	37	0	3	317	6/30/2004
A-102	Sound	WI	40	9	2	0	38	1/1/2015
A-103 <sup>(28)</sup>	Sound		383	86	9	2	372	4/1/2014
A-104	Assumed leaker		25	0	0	25	0	9/21/2015
A-105	Assumed leaker		37	0	0	37	0	1/1/2016
A-106	Sound		79	9	0	50	29	1/1/2002
6 tanks – Total			884		11	117	756	
AX Farm Status								
AX-101	Sound		358	44	0	3	355	7/1/2015
AX-102	Sound		30	0	0	6	24	1/1/2002
AX-103	Sound		107	22	0	8	99	9/30/2003
AX-104	Sound		5	0	0	5	0	10/1/2015
4 tanks – Total			500		0	24	478	
B Farm Status								
B-101	Assumed leaker		109	20	0	28	81	1/1/2002
B-102	Sound		32	7	4	0	28	6/30/1999
B-103	Assumed leaker		56	10	0	1	55	1/1/2002
B-104	Sound		374	45	0	309	65	1/1/2002
B-105	Assumed leaker		290	20	0	28	262	1/1/2002
B-106	Sound		123	8	1	122	0	12/31/2003
B-107	Assumed leaker		161	23	0	86	75	1/1/2002
B-108	Sound		92	19	0	27	65	6/30/2004
B-109	Sound		122	23	1	50	71	04/01/2015
B-110	Assumed leaker		245	27	1	244	0	1/1/2002
B-111	Assumed leaker		242	23	1	241	0	1/1/2002
B-112	Assumed leaker		35	2	3	15	17	1/1/2002
B-201	Assumed leaker		29	5	0	29	0	7/1/2004
B-202	Sound	WI	29	4	2	27	0	04/01/2015
B-203	Assumed leaker		50	5	1	49	0	04/01/2015
B-204	Assumed leaker		50	5	2	48	0	4/1/2014
16 tanks – Total			2,039		16	1,304	719	

HNF-EP-0182

Revision 337

**Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) <sup>a</sup>	Drainable Interstitial Liquid (kgal)	Waste Volumes <sup>(26)</sup>			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
BX Farm Status								
BX-101	Assumed leaker	WI	48	4	5	48	0	1/1/2002
BX-102	Assumed leaker		79	0	0	79	0	6/30/2004
BX-103	Sound	WI	77	4	15	62	0	1/1/2014
BX-104	Sound		100	4	3	97	0	1/1/2002
BX-105	Sound		72	4	5	42	25	1/1/2005
BX-106	Sound		38	4	0	10	28	1/1/2005
BX-107	Sound		347	37	0	347	0	9/18/1990
BX-108	Assumed leaker		31	4	0	31	0	1/31/2001
BX-109	Sound		193	25	0	193	0	9/17/1990
BX-110	Assumed leaker	WI	216	35	6	65	145	7/1/2014
BX-111	Assumed leaker		124	6	0	30	94	1/1/2016
BX-112	Sound		164	9	1	163	0	1/1/2002
12 tanks – Total			1,494		35	1,167	292	
BY Farm Status								
BY-101	Sound		370	24	0	37	333	4/1/2014
BY-102	Sound	WI	316	40	0	0	316	7/1/2014
BY-103	Assumed leaker	WI	417	55	0	9	408	4/1/2014
BY-104	Sound		405	44	0	46	359	1/1/2002
BY-105	Assumed leaker		481	47	0	48	433	3/31/2003
BY-106	Assumed leaker		430	37	0	32	398	12/31/2003
BY-107	Assumed leaker		271	42	0	15	256	7/1/2005
BY-108	Assumed leaker		222	33	0	40	182	1/1/2002
BY-109	Sound		287	37	0	24	263	6/30/2004
BY-110	Sound		366	20	0	43	323	1/1/2002
BY-111	Sound		402	14	0	0	402	8/25/2005
BY-112	Sound		286	24	0	2	284	3/31/2002
12 Tanks – Total			4,253		0	296	3,957	



HNF-EP-0182  
Revision 337**Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) <sup>a</sup>	Drainable  Interstitial Liquid (kgal)	Waste Volumes <sup>(26)</sup>			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
C Farm Status								
C-101	Assumed leaker	RC	6	Retrieved to limit of first and second retrieval technologies 9/25/2013 <sup>(9)</sup>				4/23/2015
C-102	Sound	RC	15	Retrieval completed 11/30/2015 <sup>(10)</sup>				10/29/2015
C-103	Sound	RC	3	Retrieval completed 8/23/2006 <sup>(11)</sup>				8/26/2006
C-104	Sound	RC	2	Retrieval completed 8/17/2012 <sup>(12)</sup>				1/1/2016
C-105 <sup>(29)</sup>	Assumed leaker	R	74	Retrieval in progress <sup>(13)</sup>				9/22/2015
C-106	Sound	RCR	3	Retrieval completed 12/31/2003 <sup>(14)</sup>				2/26/2004
C-107	Sound	RC	10	Retrieved to limit of third retrieval technology 9/30/14 <sup>(15)</sup>				3/1/2015
C-108	Sound	RC	3	Retrieved to limit of modified sluicing technology 3/22/2012 <sup>(16)</sup>				1/1/2016
C-109	Sound	RC	2	Retrieved to limit of modified sluicing technology 9/12/2012 <sup>(17)</sup>				4/1/2014
C-110 <sup>(30)</sup>	Sound	RC	2	Retrieval completed 10/30/13 <sup>(18)</sup>				1/1/2014
C-111 <sup>(31)</sup>	Sound	R	38	Retrieval in progress <sup>(19)</sup>				11/30/2015
C-112	Sound	RC	10	Retrieval completed 5/29/2014 <sup>(20)</sup>				3/4/2015
C-201	Assumed leaker	RC	0	Retrieval completed 3/23/2006 <sup>(21)</sup>				4/27/2006
C-202	Assumed leaker	RC	0	Retrieval completed 8/11/2005 <sup>(22)</sup>				8/11/2005
C-203	Assumed leaker	RC	0	Retrieval completed 3/24/2005 <sup>(23)</sup>				3/24/2005
C-204	Assumed leaker	RC	0	Retrieval completed 12/11/2006 <sup>(24)</sup>				1/31/2003
16 tanks – Total			168		27	140	0	
S Farm Status								
S-101	Sound		352	45	0	235	117	4/30/2004
S-102 <sup>(27)(32)</sup>	Sound		93	5	2	22	69	10/1/2010
S-103 <sup>(33)</sup>	Sound		237	45	1	9	227	6/30/2004
S-104	Assumed leaker		288	49	0	132	156	12/20/1984
S-105 <sup>(33)</sup>	Sound		406	42	0	2	404	1/1/2002
S-106 <sup>(33)</sup>	Sound	WI	455	26	0	0	455	2/28/2001
S-107	Sound		358	42	0	320	38	2/26/2004
S-108	Sound		550	4	0	5	545	1/1/2002
S-109	Sound		533	16	0	13	520	7/1/2004
S-110	Sound		389	30	0	96	293	7/1/2004
S-111 <sup>(27)</sup>	Sound		396	42	0	76	320	7/1/2014
S-112	Sound	RC	2	Retrieval completed 3/2/2007 <sup>(25)</sup>				4/1/2009
12 tanks – Total			4,059		3	910	3,144	

HNF-EP-0182  
Revision 337**Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) <sup>a</sup>	Drainable Interstitial Liquid (kgal)	Waste Volumes <sup>(26)</sup>			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
SX Farm Status								
SX-101	Sound		420	44	0	144	276	6/30/2004
SX-102	Sound	WI	342	37	0	55	287	4/1/2015
SX-103	Sound		509	40	0	78	431	9/30/2003
SX-104 <sup>(34)</sup>	Sound		446	48	0	136	310	4/30/2000
SX-105	Sound		375	39	0	63	312	12/31/2002
SX-106	Sound	WI	259	37	0	0	259	4/2/2014
SX-107	Assumed leaker		96	7	0	96	0	7/1/2015
SX-108	Assumed leaker		74	0	0	74	0	6/30/2004
SX-109	Assumed leaker		241	0	0	66	175	7/1/2015
SX-110 <sup>(35)</sup>	Sound		58	0	0	49	9	7/1/2015
SX-111	Assumed leaker		117	11	0	97	20	10/1/2015
SX-112	Assumed leaker		77	6	0	77	0	10/1/2015
SX-113	Assumed leaker		22	0	0	22	0	10/1/2015
SX-114	Assumed leaker		158	30	0	127	31	7/1/2004
SX-115	Assumed leaker		4	0	0	4	0	7/1/2015
15 tanks – Total			3,198		0	1,088	2,110	
T Farm Status								
T-101	Assumed leaker	WI	98	16	2	37	59	7/1/2014
T-102	Sound	FLA	32	3	13	19	0	8/31/1984
T-103	Assumed leaker		27	4	4	23	0	10/1/2004
T-104	Sound		317	31	0	317	0	11/30/1999
T-105	Sound		98	5	0	98	0	5/29/1987
T-106	Assumed leaker		22	0	0	22	0	1/1/2001
T-107	Assumed leaker	WI	173	34	0	173	0	5/31/1996
T-108	Assumed leaker		16	4	0	5	11	1/1/2001
T-109	Assumed leaker		62	11	0	0	62	1/1/2002
T-110	Sound		370	48	1	369	0	4/15/2002
T-111 <sup>(87)</sup>	Assumed leaker	AL/WI	436	38	0	436	0	3/10/2015
T-112	Sound		67	4	7	60	0	4/28/1982
T-201	Sound	WI	31	4	2	29	0	7/1/2004
T-202	Sound		20	3	0	20	0	7/1/2004
T-203	Sound		36	5	0	36	0	7/1/2004
T-204	Sound		36	5	0	36	0	7/1/2004
16 tanks – Total			1,841		29	1,680	132	



HNF-EP-0182  
Revision 337**Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) <sup>a</sup>	Drainable Interstitial Liquid (kgal)	Waste Volumes <sup>(26)</sup>			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
TX Farm Status								
TX-101	Sound		87	7	0	74	13	1/1/2002
TX-102	Sound		213	27	0	2	211	7/1/2015
TX-103	Sound		144	18	0	0	144	10/1/2015
TX-104	Sound		69	9	2	34	33	6/30/2004
TX-105	Assumed leaker		571	25	0	11	560	1/1/2002
TX-106	Sound		342	37	0	5	337	7/1/2015
TX-107	Assumed leaker		27	7	0	0	27	7/1/2015
TX-108	Sound		118	8	0	6	112	10/1/2015
TX-109	Sound		359	6	0	359	0	1/1/2002
TX-110	Assumed leaker		462	14	0	37	425	10/1/2015
TX-111	Sound		359	10	0	43	316	10/1/2015
TX-112	Sound		627	26	0	0	627	10/1/2015
TX-113	Assumed leaker		638	18	0	93	545	6/30/2004
TX-114	Assumed leaker		522	17	0	4	518	10/1/2015
TX-115	Assumed leaker		5443	25	0	8	536	10/1/2015
TX-116	Assumed leaker		599	21	0	66	533	4/30/2003
TX-117	Assumed leaker		626	10	0	29	597	401/2011
TX-118	Sound		247	31	0	0	247	6/30/2004
18 tanks – Total			6,554		2	771	5,781	
TY Farm Status								
TY-101	Assumed leaker		118	2	0	72	46	4/1/2008
TY-102	Sound	WI	72	13	8	0	64	7/1/2014
TY-103	Assumed leaker		154	23	0	103	51	6/30/2004
TY-104	Assumed leaker		44	4	1	43	0	3/31/2002
TY-105	Assumed leaker		231	12	0	231	0	4/28/1992
TY-106	Assumed leaker		16	1	0	16	0	1/1/2002
6 tanks – Totals			635		9	465	161	



HNF-EP-0182

Revision 337

**Table 4-1. Inventory and Status by Tanks – Single-Shell Tanks (6 pages)**

All volume data obtained from Tank Waste Information Network System (TWINS)

Tank (241-)	Tank Integrity	Table 1-1 Tank Status	Total Waste (kgal) <sup>a</sup>	Drainable Interstitial Liquid (kgal)	Waste Volumes <sup>(26)</sup>			Solids Volume Update
					Supernatant Liquid (kgal)	Sludge (kgal)	Saltcake (kgal)	
241-U Tank Farm Status								
U-101	Assumed leaker		23	4	0	23	0	6/30/2004
U-102	Sound		327	37	1	43	283	12/31/2002
U-103 <sup>(27)</sup>	Sound		417	33	1	11	405	1/1/2005
U-104	Assumed leaker		54	0	0	54	0	1/1/2002
U-105	Sound		353	44	0	32	321	3/30/2001
U-106	Sound		170	36	2	0	168	6/30/2004
U-107	Sound		294	32	0	15	279	12/31/2003
U-108	Sound		434	46	0	29	405	9/30/2004
U-109 <sup>(27)</sup>	Sound		401	47	0	35	366	4/30/2002
U-110	Assumed leaker		176	16	0	176	0	1/1/2002
U-111	Sound	WI	224	31	0	26	198	4/1/2014
U-112	Assumed leaker		45	4	0	45	0	2/10/1984
U-201	Sound		4	1	1	3	0	6/30/2003
U-202	Sound		4	0	1	3	0	6/30/2003
U-203	Sound		3	0	1	2	0	6/30/2003
U-204	Sound		3	0	1	2	0	6/30/2003
16 tanks – Totals			2,932		8	499	2,425	

<sup>a</sup> 1 kgal differences are the result of computer rounding (e.g., volumes reported as 0 may represent as much as 499 gal of waste).

AL = active leak  
 FLA = formal leak assessment  
 DE = level decrease evaluation.  
 IE = level increase evaluation.

R = retrieval (tank in retrieval)  
 RC = retrieval complete  
 RCR = retrieval complete – in review  
 WI = water intrusion

#### 4.1 LEAK VOLUME ESTIMATES

In HNF-EP-0182, *Waste Tank Summary Report for Month Ending September 30, 2005* (Rev. 210), the leak volume estimates were revised per RPP-23405, *Tank Farm Vadose Zone Contamination Volume Estimates*. The Washington State Department of Ecology (Ecology) submitted comments on RPP-23405 (Lyon 2005) and until these comments have been resolved, the previous leak volume estimates before Rev. 210 have been reinstated (Schepens 2006a).

Subsequent to issuance of RPP-23405, the U.S. Department of Energy (DOE) and Ecology agreed on a process to update leak volume estimates and the conclusions presented in RPP-23405 (Schepens 2006a). Pursuant to that commitment, RPP-32681, *Process to Assess Tank Farm Leaks in Support of Retrieval and Closure Planning*, established the process to develop estimates of tank farms leak loss inventories. The process is used to assess the source of tank farms leaks when necessary to support tank waste retrieval technology selections, and reassess and update volume estimates and inventories for previously identified tank leaks. If the results suggest a change to the tank's integrity classification, TFC-ENG-CHEM-D-42, "Tank Leak Assessment Process," would be invoked.

Table 4-2 uses HNF-EP-0182, Rev. 209 estimates of leak volumes for the DST and SSTs that have known or suspected leaks, unless otherwise noted. Tanks assumed to have leaked but identified via the RPP-32681 process for formal leak assessment were assessed using TFC-ENG-CHEM-D-42 and evaluated as sound. These tanks are listed at the end of the table solely for historical purposes. Endnotes to the table are provided in Section 6.1 and full reference citations are included in Section 6.2.

**Table 4-2. Tank Leak Volume Estimates (3 pages)**

Tank (241-)	Assumed Leaker <sup>(45)</sup>	Estimated Leak Volume (gal) <sup>(44)</sup>	Interim Stabilized <sup>(51)</sup>	Leak Estimate Updated	Notes (see Section 6.1)
A-104	1975	500 to 2,500	9/1978	1983	(56)(85)
A-105	1963	10,000 to 270,000	7/1979	1991	(43)(56)
AY-102	2012	190 to 520	N/A	N/A	(1)(59)(85)
B-101	1974	--	3/1981	1989	(48)(85)
B-103	1978	--	2/1985	1989	(48)(85)
B-105	1978	--	12/1984	1989	(48)(85)
B-107	1980	8,000	3/1985	1986	(49)(85)
B-110	1981	10,000	3/1985	1986	(49)(85)
B-111	1978	--	6/1985	1989	(48)(85)
B-112	1978	2,000	5/1985	1989	(48)(85)
B-201	1980	1,200	8/1981	1984	(49)(85)
B-203	1983	300	6/1984	1986	(49)(85)
B-204	1984	400	6/1984	1989	(49)(85)
BX-101	1972	--	9/1978	1989	(48)(85)



HNF-EP-0182  
Revision 337**Table 4-2. Tank Leak Volume Estimates (3 pages)**

Tank (241-)	Assumed Leaker <sup>(45)</sup>	Estimated Leak Volume (gal) <sup>(44)</sup>	Interim Stabilized <sup>(51)</sup>	Leak Estimate Updated	Notes (see Section 6.1)
BX-102	1971	70,000	11/1978	1986	(85)
BX-108	1974	2,500	7/1979	1986	(85)
BX-110	1976	--	8/1985	1989	(48)(85)
BX-111	1984	--	3/1995	1993	(48)(53)(85)
BY-103	1973	<5,000	11/1997	1983	(85)
BY-105	1984	--	3/2003	1989	(48)(85)
BY-106	1984	--	N/A	1989	(48)(85)
BY-107	1984	15,100	7/1979	1989	(49)(85)
BY-108	1972	<5,000	2/1985	1983	(85)
C-101	1980	20,000	11/1983	1986	(49)(50)(55)(85)
C-105	2010	<2,000	10/1995	2010	(29) (60)(85)
C-201	1988	550	3/1982	1987	(46)(85)
C-202	1988	450	8/1981	1987	(46)(85)
C-203	1984	400	3/1982	1986	(49)(85)
C-204	1988	350	9/1982	1987	(46)(85)
S-104	1968	24,000	12/1984	1989	(49)(85)
SX-107	1964	<5,000	10/1979	1983	(57)(85)
SX-108	1962	2,400 to 35,000	8/1979	1991	(47)(54)(57)(85)
SX-109	1965	<10,000	5/1981	1992	(47)(54)(57)(85)
SX-111	1974	500 to 2,000	7/1979	1986	(54)(57)(85)
SX-112	1969	30,000	7/1979	1986	(54)(57)(85)
SX-113	1962	15,000	11/1978	1986	(57)(85)
SX-114	1972	--	7/1979	1989	(48)(57)(85)
SX-115	1965	50,000	9/1978	1992	(57)
T-101	1992	7,500	4/1993	1992	(49)(85)
T-103	1974	<1,000	11/1983	1989	(49)(85)
T-106	1973	115,000	8/1981	1986	(49)(85)
T-107	1984	--	5/1996	1989	(48)(85)
T-108	1974	<1,000	11/1978	1980	(49)
T-109	1974	<1,000	12/1984	1989	(49)(85)
T-111	1979, 1994	<3,500	2/1995	2013	(49)(52)(85)
TX-105	1977	--	4/1983	1989	(48)(85)

HNF-EP-0182  
Revision 337**Table 4-2. Tank Leak Volume Estimates (3 pages)**

<b>Tank (241-)</b>	<b>Assumed Leaker<sup>(45)</sup></b>	<b>Estimated Leak Volume (gal)<sup>(44)</sup></b>	<b>Interim Stabilized<sup>(51)</sup></b>	<b>Leak Estimate Updated</b>	<b>Notes (see Section 6.1)</b>
TX-107	1984	2,500	10/1979	1986	(47)(85)
TX-110	1977	--	04/1983	1989	(48)(85)
TX-113	1974	--	4/1983	1989	(48)(85)
TX-114	1974	--	4/1983	1989	(48)(85)
TX-115	1977	--	9/1983	1989	(48)(85)
TX-116	1977	--	4/1983	1989	(48)(85)
TX-117	1977	--	3/1983	1989	(48)(85)
TY-101	1973	<1,000	4/1983	1980	(49)(58)
TY-103	1973	3,000	2/1983	1986	(58)(85)
TY-104	1981	1,400	11/1983	1986	(49)(58)(85)
TY-105	1960	35,000	2/1983	1986	(58)(85)
TY-106	1959	20,000	11/1978	1986	(58)(85)
U-101	1959	30,000	9/1979	1986	(85)
U-104	1961	55,000	10/1978	1986	(85)
U-110	1975	5,000 to 8,100	12/1984	1986	(49)(85)
U-112	1980	8,500	9/1979	1986	(49)(85)
<b>62 tanks</b>					
<b>Assumed Leakers Assessed per TFC-ENG-CHEM-D-42 and Evaluated as Sound</b>					
A-103	1987	5,500	6/1988	1987	(28)
AX-102	1988	3,000	9/1988	1989	(79)
AX-104	1977	--	8/1981	1989	(81)
C-110	1984	2,000	5/1995	1989	(30)
C-111	1968	5,500	3/1984	1989	(31)
SX-104	1988	6,000	4/2000	1988	(34)
SX-110	1976	5,500	8/1979	1989	(35)
<b>6 tanks</b>					

## 4.2 WATER INTRUSION IN SINGLE-SHELL TANKS

Since November 2012, all SST videos (excluding those for retrieval activities) have included evaluation of the tank for water intrusion. Table 4-3 lists those tanks currently identified as having an intrusion. To be included on this list, an SST must meet one of two criteria:

1. An intrusion is observed entering the tank during inspection or subsequent video reviews.
2. An intrusion is not observed during inspection. Liquid is covering at least part of the waste surface, comparison to past in-tank images shows an increase in visible liquid, and the surface or interstitial liquid level indicate an intrusion is occurring.

**Table 4-3. Single-Shell Tanks with Confirmed Water Intrusion**

Tank (241-)	Date of Video Inspection <sup>a</sup>	Notes (see Section 6.1)
A-102	1/21/2014	(86)
B-202	1/28/2014	(86)
BX-101	3/11/2013	(86)
BX-103	3/25/2013	(86)
BX-110	2/27/2013	(86)
BY-102	12/28/2012	(86)
BY-103	2/25/2014	(86)
S-106	3/4/2014	(86)
SX-102	11/21/2013	(86)
SX-106	04/15/2013	(86)
T-101	3/10/2014	(86)
T-107	1/4/2016	
T-111	12/30/2013	(86)
T-201	3/26/2014	(86)
TY-102	3/7/2014	(86)
U-111	2/19/2014	(86)

<sup>a</sup> November 2012 and later inspections only, retrieval-related inspections not included. Number of SSTs inspected since November 2012 = 42.

SST = single-shell tank



HNF-EP-0182  
Revision 337

Table 4-4 lists SSTs identified as having an intrusion in recent years, but the intrusion is not confirmed as currently continuing. To be included in Table 4-4 an SST must meet the following criterion:

1. An intrusion is not observed during inspection. Liquid is covering at least part of the waste surface, comparison to past in-tank images shows an increase in visible liquid, but the surface level or interstitial liquid level are either unavailable or inconclusive as to whether an intrusion is occurring.

**Table 4-4. Single-Shell Tanks with Evidence of Recent Water Intrusion**

Tank (241-)	Date of Video Inspection <sup>a</sup>	Notes (see Section 6.1)
A-103	1/21/2014	(86)
B-109	1/28/2014	(86)
BY-101	3/11/2013	(86)
S-111	3/25/2013	(86)
TX-108	3/18/2015	(88)

<sup>a</sup> November 2012 and later inspections only, retrieval-related inspections not included. Number of SSTs inspected since November 2012 = 42.

SST = single-shell tank

HNF-EP-0182  
Revision 337

This page intentionally left blank.

HNF-EP-0182

Revision 337

## 5.0 MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

Table 5-1 and Table 5-2 reflect miscellaneous underground storage tanks and special surveillance facilities in the 200 East and 200 West Areas, respectively, which have traditionally been managed by the tank farms operating contractor, based on WHC-SD-WM-TI-356, *Waste Storage and Leak Detection Criteria*. Assignment of long-term stewardship responsibility has not been determined in some cases.

**Table 5-1. 200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)**

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal <sup>a</sup> )	Volume Date	Notes (see Section 6.1)
204-AR/ 204-AR-TK-1	West of A Farm complex	Liquid waste from 100 Area, 300 Area rail and highway tankers	0.71	3/22/2009	(69)
204-AR/ 204-AR-Sump	West of A Farm complex	Liquid waste from 100 Area, 300 Area rail and highway tankers	No data	--	--
209-E-TK-111	209-E Building	Decon catch tank	No data	--	--
241-A-302-A	A Farm	A-151 diversion box	0.61	1/13/2015	--
241-A-302-B	A Farm	A-152 diversion box	6.0	12/8/2014	--
241-A-350	A Farm	Collects drainage	0.11	6/22/2015	--
241-A-417	A Farm	Condensate/drainage from A and AX Farm Tanks 702-A HVAC, A-401 surface condenser seal loops, AZ-154 steam coil	1.2	2/17/2015	--
241-AX-151 catch tank	North of PUREX	PUREX Plant	2.8	8/2/2006	(68)
241-AX-151 (4 diverter tanks)	North of PUREX	PUREX Plant	No data	--	(68)
241-AX-152 catch tank	AX Farm	AX-152 diversion box, AX-151 diverter	<0.10	12/4/2014	(77)
241-AX-152 (2 diverter tanks)	AX Farm	AX-152 diversion box	No data	--	(77)
241-AZ-151	AZ Farm	AZ-702 condensate	2.3	12/10/2014	--
241-AZ-154	AZ Farm	AZ-101 and AZ-102 steam condensate	<0.10	7/31/2008	--
241-AZ-301	AZ Farm	AZ-702 condensate	N/A	--	(71)
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 diversion box	0.54	4/24/1985	--
241-B-302-B	B Farm	B-154 diversion box	5.0	5/10/1985	--

HNF-EP-0182

Revision 337

**Table 5-1. 200 East Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (3 pages)**

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal <sup>a</sup> )	Volume Date	Notes (see Section 6.1)
241-BX-302-A	BX Farm	BX-152, BX-153, BXR-152, BYR-152 diversion box	0.83	3/14/1984	--
241-BX-302-B	BX Farm	BX-154 diversion box	1.0	5/8/1985	--
241-BX-302-C	BX Farm	BX-155 diversion box	0.84	4/11/1985	--
241-BY-ITS2-TK 1	BY Farm	Vapor condenser	No data	--	--
241-BY-ITS2-TK 2	BY Farm	Heater flush tank	0.78	8/24/2006	--
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 diversion box	10.5	5/31/1985	--
241-ER-311	Southwest of B Plant	ER-151, ER-152 diversion box	<0.10	12/23/2014	(63)
241-ER-311A	Southwest of B Plant	ER-151 diversion box	Empty	--	--
244-A-TK	A Farm complex	DCRT (receives from several locations)	4.9	10/23/2014	--
244-A-Sump	A Farm complex	DCRT (receives from several locations)	<0.10	10/23/2014	--
244-AR Vault/TK-244-AR-001	A Farm complex	A and AX Farms	0.66	10/23/2014	(72)
244-AR Vault/Sump-AR-001	A Farm complex	Process jumper connection leaks or cell decon washdowns	<0.10	10/23/2014	(72)
244-AR Vault/TK-244-AR-002	A Farm complex	A and AX Farms	2.1	2/18/2015	(72)
244-AR Vault/Sump-AR-002	A Farm complex	Process jumper connection leaks or cell decon washdowns	<0.10	10/23/2014	(72)
244-AR Vault/TK-244-AR-003	A Farm complex	A and AX Farms	<0.10	10/23/2014	(72)
244-AR Vault/Sump-AR-003	A Farm complex	Process jumper connection leaks or cell decon washdowns	5.8	2/18/2014	(72)
244-AR Vault/TK-244-AR-004	A Farm complex	A and AX Farms	<0.10	10/30/2014	(72)
244-BX-TK	BX Farm complex	B, BX, and BY Farm saltwells	11.0	3/31/2015	--
244-BX-Sump	BX Farm complex	B, BX, and BY Farm saltwells	<0.10	3/31/2015	--
244-BXR Vault/TK-BXR-001	BX Farm	BX Farm and diversion boxes	4.1	11/1984	--
244-BXR Vault/Sump-BXR-001	BX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	4/1984	--



HNF-EP-0182  
Revision 337**Table 5-1. 200 East Area Miscellaneous Underground Storage Tanks  
and Special Surveillance Facilities (3 pages)**

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal <sup>a</sup> )	Volume Date	Notes (see Section 6.1)
244-BXR Vault/ TK-BXR-002	BX Farm	BX Farm and diversion boxes	1.1	2/20/1985	--
244-BXR Vault/ Sump-BXR-002	BX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	2/1985	--
244-BXR Vault/ TK-BXR-003	BX Farm	BX Farm and diversion boxes	0.79	2/18/1985	--
244-BXR Vault/ Sump-BXR-003	BX Farm	Process jumper connection leaks or cell decon washdowns	7.2	2/18/1985	--
244-BXR Vault/ TK-BXR-011	BX Farm	BX Farm and diversion boxes	4.0	4/1984	--
244-BXR Vault/ Sump-BXR-011	BX Farm	Process jumper connection leaks or cell decon washdowns	7.6	1/24/1985	--
244-CR Vault/ TK-CR-001	C Farm	B, BX, BY, C Farm sludge slurry	4.3	6/8/2015	(70)
244-CR Vault/ Sump-CR-001	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	3/3/2010	(70)
244-CR Vault/ TK-CR-002	C Farm	244-CR Vault Tank CR-001	0.75	11/29/2004	(70)
244-CR Vault/ Sump-CR-002	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	3/09/2010	(70)
244-CR Vault/ TK-CR-003	C Farm	Former C Farm saltwell receiver tank	2.3	12/23/2014	(70)
244-CR Vault/ Sump-CR-003	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	3/10/2010	(70)
244-CR Vault/ TK-CR-011	C Farm	244-CR Vault Tanks CR-002 and CR-003	4.0	11/30/2004	(70)
244-CR Vault/ Sump-CR-011	C Farm	Process jumper connection leaks or cell decon washdowns	<0.10	2/25/2010	(70)

<sup>a</sup> Nominal volume of remaining waste is in kgal, unless noted otherwise.

DCRT = double-contained receiver tank. PUREX = plutonium/uranium extraction.  
 HVAC = heating, ventilation, and air conditioning.



HNF-EP-0182  
Revision 337**Table 5-2. 200 West Area Miscellaneous Underground Storage Tanks  
and Special Surveillance Facilities (3 pages)**

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal <sup>a</sup> )	Volume Date	Notes (see Section 6.1)
213W-TK-1	East of 213-W Compactor Facility	Water retention tank	1.6	3/19/1999	--
231-W-151-001	North of Z Plant	231-Z floor drains	1.4	8/15/1974	--
231-W-151-002	North of Z Plant	231-Z floor drains	0.96	8/15/1974	--
240-S-302	North of REDOX Plant	240-S-151 diversion box	1.7	10/1/2014	(64)
241-E/W-151 Vent Station Catch Tank	South of 609-A	Cross-site transfer lines/encasement	0.55	4/15/2015	(66)
241-S-302A	S Farm	S-151 diversion box	0.30	3/19/2001	(82)
241-S-302B	SX Farm	S encasements	<0.10	4/1984	--
241-S-304	S Farm	S-151 diversion box	0.13	10/27/2015	--
241-SX-302	SX Farm	SX-151 diversion box, SX-152 transfer box	1.4	11/1984	--
241-T-301	T Farm	T-151, T-152, T-153, T-252 diversion box	22.0	7/3/1985	--
241-TX-302A	TX Farm	TX-153 diversion box	2.5	8/1984	--
241-TX-302B	East of TX Farm	TX-155 diversion box	1.7	1/13/2015	(83)
241-TX-302-B(R)	East of TX Farm	TX-155 diversion box	No data	--	(83)
241-TX-302C	T Plant	TX-154 diversion box	0.36	5/21/2015	--
241-TX-302-X-B	TX Farm	TX encasements	0.34	8/1984	--
241-TY-302A	TY Farm	TY-153 diversion box	0.46	6/25/1985	--
241-TY-302B	TY Farm	TY encasements	<0.10	8/1984	--
241-U-301B	U Farm	U-151, U-152, U-153, U-252 diversion box	1.5	1/5/2015	--
241-UX-302A	U Plant	UX-154 diversion box	0.85	5/18/2015	(65)
241-Z-8 (216-Z-8)	East of Z Plant	RECUPLEX	0.50	10/19/1974	--
242-S TK C-100	242-S Evaporator	242-S Evaporator process condensate	8.0	--	--
242-T-135	T Evaporator	T Evaporator	No data	--	(76)
242-TA-R1	T Evaporator	Z Plant	No data	--	(75)
242-TA-Sump	T Evaporator	Z Plant	<0.10	9/24/2010	(75)

HNF-EP-0182  
Revision 337**Table 5-2. 200 West Area Miscellaneous Underground Storage Tanks  
and Special Surveillance Facilities (3 pages)**

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal <sup>a</sup> )	Volume Date	Notes (see Section 6.1)
243-S-TK-1	Northwest of S Farm	Personnel decontamination facility	No data	--	--
244-S-TK	S Farm	From SSTs for transfer to Tank SY-102	3.6	2/4/2015	--
244-S-Sump	S Farm	From SSTs for transfer to Tank SY-102	0.10	3/17/2015	--
244-TX-TK	TX Farm	Z Plant	6.9 gal	3/3/2015	--
244-TX-Sump	TX Farm	Z Plant	<0.10 gal	6/13/2011	--
244-TXR Vault/ TK-TXR-001	TX Farm	Transfer lines, TXR-151 diversion box	0.47	10/1984	--
244-TXR Vault/ Sump-TXR-001	TX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	10/1984	--
244-TXR Vault/ TK-TXR-002	TX Farm	Transfer lines	1.9	10/1984	--
244-TXR Vault/ Sump-TXR-002	TX Farm	Process jumper connection leaks or cell decon washdowns	0.10	10/1984	--
244-TXR Vault/ TK-TXR-003	TX Farm	Transfer lines	5.3	10/1984	--
244-TXR Vault/ Sump-TXR-003	TX Farm	Process jumper connection leaks or cell decon washdowns	<0.10	10/1984	--
244-U-TK	U Farm	U Farm saltwell liquids	1.9	11/3/2010	--
244-U-Sump	U Farm	Process jumper connection leaks or cell decon washdowns	No data	--	(84)
244-UR Vault/ TK-UR-001	U Farm	U Farm	0.42	7/1984	--
244-UR Vault/ Sump-UR-001	U Farm	Process jumper connection leaks or cell decontamination washdowns	1.2	6/26/1984	--
244-UR Vault/ TK-UR-002	U Farm	U Farm	1.5	7/11/1984	--
244-UR Vault/ Sump-UR-002	U Farm	Process jumper connection leaks or cell decontamination washdowns	<0.10	7/8/1984	--

HNF-EP-0182  
Revision 337

**Table 5-2. 200 West Area Miscellaneous Underground Storage Tanks  
and Special Surveillance Facilities (3 pages)**

Facility	Location	Received Waste From	Nominal Volume of Remaining Waste (kgal <sup>a</sup> )	Volume Date	Notes (see Section 6.1)
244-UR Vault/ TK-UR-003	U Farm	U Farm	0.60	7/1984	--
244-UR Vault/ Sump-UR-003	U Farm	Process jumper connection leaks or cell decontamination washdowns	3.4	6/21/1984	--
244-UR Vault/ 244-UR-004	U Farm	U Farm	No data	--	(74)

<sup>a</sup> Nominal volume of remaining waste is in kgal, unless noted otherwise.

RECUPLEX = recovery of uranium and plutonium by  
extraction.

REDOX = reduction-oxidation.  
SST = single-shell tank.



## 6.0 ENDNOTES AND REFERENCES

### 6.1 REPORT ENDNOTES

Table 6-1 includes all endnotes for the tables found in Sections 1.0 through 5.0 of this report. When an endnote is referenced multiple times, the location column shows each table referencing the endnote.

**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(1)	RPP-ASMT-53793, <i>Tank 241-AY-102 Leak Assessment Report</i> , states that Tank AY-102 was declared an “Assumed Leaker – Primary Tank” on October 19, 2012, due to the results of a leak assessment performed on discovery of waste material in the tank’s annulus space. The ORP was notified of the intention to change the tank’s leak integrity classification (Clark 2012).	Table 1-1, Table 4-2
(2)	SSTs in level increase evaluation – Tanks being evaluated for waste level increase per RPP-PLAN-55112, <i>September 2012 Single-Shell Tank Waste Level Increase Evaluation Plan</i> .	Table 1-1
(3)	SSTs in level decrease evaluation – Tanks being evaluated for waste level decrease per RPP-PLAN-55113, <i>March 2013 Single-Shell Tank Waste Level Decrease Evaluation Plan</i> .	Table 1-1
(4)	SSTs in retrieval – Tanks with active bulk or heel retrieval operations in progress or awaiting heel retrieval (e.g., Tanks C-102, C-105, C-111).	Table 1-1
(5)	Retrieval operations complete – Tanks have active retrieval operations completed (e.g., Tanks C-101, C-102, C-103, C-104, C-107, C-108, C-109, C-110, C-112, C-201, C-202, C-203, C-204, and S-112); retrieval data report and/or retrieval completion certification have been provided to ORP for review and submittal to Ecology. Letter of Completion for Retrieval Data Report (from ORP to Ecology) for the following tanks: <ul style="list-style-type: none"> <li>Tank C-103 (letter 07-TPD-026, dated May 21, 2007 [Olinger 2007a])</li> <li>Tank C-201 (letter 06-TPD-071, dated November 2, 2006 [Schepens 2006b])</li> <li>Tank C-202 (letter 06-TPD-051, dated July 31, 2006 [Schepens 2006c])</li> <li>Tank C-203 (letter 06-TPD-005, dated January 18, 2006 [Schepens 2006d])</li> <li>Tank C-204 (letter 07-TPD-043, dated August 9, 2007 [Olinger 2007b])</li> <li>Tank S-112 (letter 07-TPD-066, dated December 21, 2007 [Olinger 2007c]).</li> </ul> Retrieval completion certifications provided by ORP to Ecology for the following tanks: <ul style="list-style-type: none"> <li>Tank C-101 (letter 14-TF-0113, dated September 24, 2014 [Smith 2014b])</li> <li>Tank C-102 (letter 15-TF-0116, dated November 30, 2015 [Smith 2015])</li> <li>Tank C-104 (letter 13-TF-0018, dated March 21, 2013 [Fletcher 2013a])</li> <li>Tank C-107 (letter 14-TF-0114, dated September 30, 2014 [Smith 2014c])</li> <li>Tank C-108 (letter 13-TF-0025, dated May 1, 2013 [Fletcher 2013b])</li> <li>Tank C-109 (letter 13-TF-0037, dated June 4, 2013 [Smith 2013])</li> <li>Tank C-110 (letter 14-TF-0007, dated January 29, 2014 [Smith 2014a]).</li> <li>Tank C-112 (letter 14-TF-0115, dated September 30, 2014 [Smith 2014d]).</li> </ul>	Table 1-1 Table 2-1
(6)	Retrieval operations complete and in review – Tank(s) have active retrieval operations completed (e.g., Tanks C-106); report or practicability evaluation is pending approval; or evaluation has been accepted, but final completion letter or certification submittal is pending.	Table 1-1
(8)	Nominal volume of waste inventory is the best estimate of residual volume. Retrieval data reports also provide 95 percent upper confidence level volume as the bounding estimate of remaining waste.	Table 2-1



HNF-EP-0182  
Revision 337**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(9)	Tank C-101 nominal waste volume – Total waste 4,995 gal (RPP-CALC-56434, <i>Post-Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-101</i> ) revised to 5.5 kgal (RPP-RPT-54440, <i>Derivation of Best-Basis Inventory for Tank 241-C-101 as of April 23, 2015</i> )	Table 2-1, Table 4-1
(10)	Tank C-102 nominal waste volume estimate – Total waste 15,480 gal (RPP-RPT-59004, <i>Post Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-102</i> ).	Table 2-1, Table 4-1
(11)	Tank C-103 nominal waste volume – Total waste 2,529 gal, sludge 2,282 gal, supernatant 247 gal (RPP-RPT-33060, <i>Retrieval Data Report for Single-Shell Tank 241-C-103</i> ).	Table 2-1, Table 4-1
(12)	Tank C-104 nominal waste volume – Total waste 1,8 kgal of sludge (RPP-RPT-46616, <i>Derivation of Best-Basis Inventory for Tank 241-C-104 as of January 1, 2016</i> ).	Table 2-1, Table 4-1
(13)	Tank C-105 nominal waste volume estimate – Total waste 73,841 gal remaining at the end of September 2015, based on the retrieval engineer's data.	Table 2-1, Table 4-1
(14)	Tank C-106 nominal waste volume – Total waste 2,771 gal, sludge 2,686 gal, supernatant 85 gal (RPP-20577, <i>Stage II Retrieval Data Report for Single-Shell Tank 241-C-106</i> ).	Table 2-1, Table 4-1
(15)	Tank C-107 waste volume estimate – Total waste 10 kgal sludge (RPP-RPT-48745, Rev. 9, <i>Derivation of Best-Basis Inventory for Tank 241-C-107 as of March 1, 2015</i> ).	Table 2-1, Table 4-1
(16)	Tank C-108 nominal waste volume – Total waste 3.3 kgal sludge (RPP-RPT-45147, <i>Derivation of Best-Basis Inventory for Tank 241-C-108 as of January 1, 2016</i> ).	Table 2-1, Table 4-1
(17)	Tank C-109 nominal waste volume – Total waste 2,004 gal (RPP-CALC-54759, <i>Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-109</i> ).	Table 2-1, Table 4-1
(18)	Tank C-110 nominal waste volume – Total waste 1,776 gal (RPP-CALC-56399, <i>Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-110</i> ).	Table 2-1, Table 4-1
(19)	Tank C-111 volume estimate – Total waste of 38,405 gal remaining at the end of January, according to the retrieval engineer's data.	Table 2-1, Table 4-1
(20)	Tank C-112 waste volume estimate – Total waste 12,700 gal (RPP-CALC-56856, <i>Estimated Waste Volume Remaining in Single-Shell Tank 241-C-112 after Hard Heel Retrieval</i> ); revised to 10,000 gal (RPP-RPT-52516, <i>Derivation of Best-Basis Inventory For Tank 241-C-112 as of March 3, 2015</i> ).	Table 2-1, Table 4-1
(21)	Tank C-201 nominal waste volume – Total waste 144 gal, sludge 142 gal, supernatant 2 gal (RPP-29441, <i>Post-Retrieval Waste Volume Determination for Single-Shell Tank 241-C-201</i> ).	Table 2-1, Table 4-1
(22)	Tank C-202 nominal waste volume – Total waste 147 gal, sludge 145 gal, supernatant 2 gal (RPP-RPT-29095, <i>Retrieval Data Report for Single-Shell Tank 241-C-202</i> ).	Table 2-1, Table 4-1
(23)	Tank C-203 nominal waste volume – Total waste 139 gal, sludge 126 gal, supernatant 13 gal (RPP-RPT-26475, <i>Retrieval Data Report for Single-Shell Tank 241-C-203</i> ).	Table 2-1, Table 4-1
(24)	Tank C-204 nominal waste volume – Total waste 137 gal, sludge 134 gal, supernatant 3 gal (RPP-RPT-34062, <i>Retrieval Data Report for Single-Shell Tank 241-C-204</i> ).	Table 2-1, Table 4-1
(25)	Tank S-112 nominal waste volume – Total waste 2,387 gal, sludge/saltcake 2,263 gal, supernatant 124 gal (RRP-RPT-35112, <i>Retrieval Data Report for Single-Shell Tank 241-S-112</i> ).	Table 2-1, Table 4-1
(26)	For some tanks, a volume difference exists between estimates published in HNF-SD-RE-TI-178, <i>Single-Shell Tank Interim Stabilization Record</i> , and later TWINS estimates. TWINS estimates are reported in Table 4-1.	Table 4-1
(27)	Tank A-101 contains retained gas in saltcake; Tanks S-102, S-111, U-103, and U-109 contain retained gas in saltcake and sludge.	Table 4-1
(28)	Status of Tank A-103 changed from "assumed leaker" to "sound" per RPP-ASMT-42278, <i>Tank 241-A-103 Leak Assessment Report</i> .	Table 4-1, Table 4-2



HNF-EP-0182  
Revision 337**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(29)	Status of Tank C-105 changed from “sound” to “assumed leaker” per RPP-ASMT-46452, <i>Tank 241-C-105 Leak Assessment Completion Report</i> .	Table 4-1, Table 4-2
(30)	Status of Tank C-110 changed from “assumed leaker” to “sound” per RPP-ASMT-38219, <i>Tank 241-C-110 Leak Assessment Report</i> .	Table 4-1, Table 4-2
(31)	Status of Tank C-111 changed from “assumed leaker” to “sound” per RPP-ASMT-39155, <i>Tank 241-C-111 Leak Assessment Report</i> .	Table 4-1, Table 4-2
(32)	Retrieval operations began in Tank S-102 on December 16, 2004, and were suspended in July 2007. Actions were subsequently taken to reduce the remaining liquid volume to below interim stabilization criteria. A letter was submitted to DOE on June 1, 2010, that stated Tank S-102 again met interim stabilization criteria (Sax 2010).	Table 4-1
(33)	The <i>Hanford Federal Facility Agreement and Consent Order</i> (signed August 2004) modified Milestone M-45-00C (Change Order M-45-04-01) changing the regulatory requirements for retrieval of waste in Tanks S-103, S-105, and S-106 (Ecology et al 1989). “Retrieval” status in these tanks is thereby rescinded.	Table 4-1
(34)	Status of Tank SX-104 changed from “assumed leaker” to “sound” per RPP-ASMT-48143, <i>Tank 241-SX-104 Leak Assessment Completion Report</i> .	Table 4-1, Table 4-2
(35)	Status of Tank SX-110 changed from “assumed leaker” to “sound” per RPP-ASMT-47140, <i>Tank 241-SX-110 Leak Assessment Report</i> .	Table 4-1, Table 4-2
(43)	WHC-MR-0264, <i>Tank 241-A-105 Leak Assessment</i> , estimated that 610 kgal of cooling water was added to Tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with <i>Washington Administrative Code</i> (WAC) 173-303-070 (2)(a)(ii), any of this added cooling water that has subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water that leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 kgal) is based on the following: <ul style="list-style-type: none"> <li>WHC-MR-0264 estimates 5 to 15 kgal for the initial leak prior to August 1968. WHC-MR-0264 also estimates 5 to 30 kgal for the leak while the tank was being sluiced from August 1968 to November 1970. WHC-MR-0264 estimates that 610 kgal of cooling water was added to the tank from November 1970 to December 1978, and leakage was estimated to be small during this period. This reference states “Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water.” This results in a low estimate of zero gallons leakage from November 1970 to December 1978.</li> <li>WHC-EP-0410, <i>Tank 241-A-105 Evaporation Estimate 1970 Through 1978</i>, estimates that 378 to 410 kgal evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 kgal of cooling water leakage from November 1970 to December 1978.</li> </ul>	Table 4-2

Time period	Low estimate	High estimate
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	0	232,000
<b>Totals</b>	<b>10,000</b>	<b>277,000</b>



HNF-EP-0182  
Revision 337**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(44)	Tank leak volume estimates are being updated as a result of tank leak volume assessments and review of tanks for retrieval/closure consideration. The tank leak volume estimates do not include (with some exceptions): (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.	Table 4-2
(45)	In many cases, a leak was suspected long before it was identified or confirmed. For example, SD-WM-SAR-006, <i>Single-Shell Tank Isolation Safety Analysis Report</i> , shows that Tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the “assumed leaker” date of 1961. Using present standards, Tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of “suspected leaker,” “questionable integrity,” “confirmed leaker,” “declared leaker,” and “borderline and dormant” were merged into one category now reported as “assumed leaker.” Catlin (1980) describes when, how long, and how fast some of the tanks leaked.	Table 4-2
(46)	The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.	Table 4-2
(47)	The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating a continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (There are currently no functioning laterals and no plan to prepare them for use).	Table 4-2
(48)	Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in Baumhardt (1989) and Jensen/Merril (1989). The total leak volume estimate for these tanks is 150 kgal (rounded to the nearest kgal), for an average of approximately 8 kgal for each of 19 tanks.	Table 4-2
(49)	Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.	Table 4-2
(50)	Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a “questionable integrity” tank. Liquid level data show decreases in level throughout the 1970s, and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a “confirmed leaker” in January 1980 (WHC-MR-0132, <i>A History of the 200 Area Tank Farms</i> , and WHC-SD-EN-TI-185, <i>Assessment of Unsaturated Zone Radionuclide Contamination Around Single Shell Tanks 241-C-105 and 241-C-106</i> ). WHC-SD-EN-TI-185 provides information on the potential for leaks from other C Farm tanks (specifically Tanks C-102, C-103, and C-109).	Table 4-2
(51)	These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.	Table 4-2
(52)	Tank T-111 was declared an “assumed re-leaker” on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization was completed on February 22, 1995. RPP-RPT-54964, <i>Evaluation of Tank 241-T-111 Level Data and In-Tank Video Inspection</i> , estimated that from 1995 to January 1, 2014, Tank T-111 leaked approximately 2,500 gal. The value reported in Table 4-2 sums the <1,000 gal reported in 1994, with the approximately 2,500 gal reported in 2013.	Table 4-2



HNF-EP-0182  
Revision 337**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(53)	Tank BX-111 was declared an “assumed re-leaker” in April 1993. Preparations for pumping were delayed following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.	Table 4-2
(54)	The leak volume and curie release estimates on Tanks SX-108, SX-109, SX-111, and SX-112 have been reevaluated using a historical leak model (HNF-3233, <i>Re-Analysis of SX Farm Leak Histories with the Historical Leak Model Rev. 1 [HLMr]</i> ). In general, the model estimates are much higher than the values listed in Table 4-2, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, “In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology” (HNF-3233).	Table 4-2
(55)	Leak from Tank C-101 was re-assessed in RPP-ENV-33418, <i>Hanford C-Farm Leak Assessments Report</i> . Revised leak volumes presented in the report have not yet been adopted in Table 4-2.	Table 4-2
(56)	Leaks from Tanks A-104 and A-105 were re-assessed in RPP-ENV-37956, <i>Hanford 241-A/AX Farm Leak Inventory Assessment Report</i> . Revised leak volumes presented in the report have not yet been adopted in Table 4-2.	Table 4-2
(57)	Leaks from Tanks SX-107, SX-108, SX-109, SX-111, SX-112, SX-113, SX-114, and SX-115 were re-assessed in RPP-ENV-39658, <i>Hanford SX-Farm Leak Assessments Report</i> . Revised leak volumes presented in the report have not yet been adopted in Table 4-2.	Table 4-2
(58)	Leaks from Tanks TY-101, TY-103, TY-104, TY-105, and TY-106 were re-assessed in RPP-RPT-42296, <i>Hanford TY-Farm Leak Assessments Report</i> . Revised leak volumes presented in the report have not been adopted pending completion of a formal leak assessment of Tank TY-101 using TFC-ENG-CHEM-D-42.	Table 4-2
(59)	RPP-ASMT-53793 states that at the time of publication, the leak volume was estimated to be between 190 to 520 gal. A significant portion of the liquid had evaporated, leaving about 20 to 50 gal of drying waste in the tank annulus space. The total estimated volume of drying waste in the annulus is <60 gal. at the end of June, 2015.	Table 4-2
(60)	A reevaluation of the Tank C-105 leak integrity using TFC-ENG-CHEM-D-42 was completed in May 2010, concluding that a leak from the tank could not be ruled out by the evidence from recently completed Direct Push C7469 and other available data, and recommending that the leak integrity status be revised to “assumed leaker.” The estimated leak volume was <2,000 gal (RPP-ASMT-46452).	Table 4-2
(63)	<p>A leak assessment was performed because of the 0.5-in. liquid level decrease between early October 2005 and January 31, 2006. The leak assessment, issued on March 17, 2006, concluded that a tank leak was the most likely explanation for the level trend (RPP-RPT-29163, <i>Tank 241-ER-311 Leak Assessment Report</i>).</p> <p>The solids volume in the tank is not known. Sample activities conducted during November 1999 concluded that there were approximately 7 to 9 in. of solids beneath the east riser and no solids beneath the west riser (HNF-5985, <i>ER-311 Flammable Gas Response and Findings</i>). The remaining liquid in the tank was evaporated to dryness between October 13, 2006 and February 15, 2007. A subsequent video inspection on March 17, 2007, indicated no remaining free liquid was present (Olinger 2007d).</p>	Table 5-1



**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(64)	<p>A leak assessment was performed because of a steady, predictable liquid level decrease of approximately 0.33 in./year since the early 1980s. The tank was designated as an “assumed leaker” in 1985, but had no record of a formal leak assessment. The leak assessment report was issued on October 10, 2007 (RPP-ASMT-35057, <i>Tank 240-S-302 Leak Assessment Report</i>).</p> <p>A total of 6,265 gal of supernatant was pumped from the tank between September 21, 2008 and September 28, 2008. A solids level of 14.12 in. (1,361 gal) was measured with an ENRAF densitometer on September 9, 2008. A post-pumping visual inspection showed a small 1-ft wide by 10-ft long pool of liquid centered beneath the pump, corresponding to less than 6 gal of free liquid. The remaining volume is estimated to be 1,360 to 1,660 gal, based on ENRAF and densitometer readings in different risers, and assuming that the solids are level across the tank.</p>	Table 5-2
(65)	<p>A leak assessment was performed because of the 0.7-in. level decrease between January 2004 and February 2006. The leak assessment concluded that a tank leak was the most likely explanation for the level trend. The leak assessment report was issued on May 12, 2006 (RPP-RPT-29711, <i>Tank 241-UX-302A Leak Assessment Report</i>).</p> <p>Pumping of the remaining free liquid from the tank was completed October 25, 2006 (Schepens 2006e). An estimated 75 to 110 gal of sludge and 10 gal of free liquid remained in the tank (RPP-RPT-31779, <i>241-UX-302A Catch Tank Liquid Mitigation Completion Report</i>).</p> <p>Following additional liquid intrusion, the tank was pumped August 27, 2009 (RPP-RPT-42789, <i>Completion of Removal of Pumpable Liquid From 241-UX-302A</i>), June 21, 2012, to August 7, 2012 (Work Package TFC-WO-11-5930 WCN-2), and May 3, 2015 (Work Order #WO-163708). ENRAF liquid level readings estimate that approximately 140 gallons of sludge and liquid remain in the tank.</p>	Table 5-2
(66)	<p>A leak assessment was performed because of a 1.25-in. liquid level decrease between July 2006 and November 2006. The leak assessment concluded that the level decrease was the result of evaporation from an operating exhaustor connected to catch tank 241-ER-311. This was confirmed when the exhaustor was shut down and the liquid level stabilized. The tank remains classified as a “sound” tank. The leak assessment report was issued on June 25, 2007 (RPP-ASMT-33741, <i>Tank 241-EW-151 Leak Assessment Report</i>).</p>	Table 5-2
(68)	<p>241-AX-151 consists of four 50-gal diverter tanks (Tanks D – G) located in individual cells and the approximate 12,200-gal capacity 241-AX-151-CT catch tank (stainless steel lined concrete vault and sump) receiving drainage from the pump pit and the four cells.</p>	Table 5-1
(69)	<p>204-AR Customer Waste Unloading Facility includes a 1,500-gal catch tank enclosed in a stainless steel lined pit and pit sump; combined capacity of the catch tank and pit are 4,550 gal (WHC-SD-WM-SAR-040, <i>Safety Analysis Report for the 204-AR Waste Unloading Facility</i>).</p>	Table 5-1
(70)	<p>244-CR Vault contains two 40-kgal tanks, CR-011 and CR-001, and two 15-kgal tanks, CR-002 and CR-003, in individual cells. The contents of the 244-CR Vault cells were pumped to Tank C-104 during retrieval of Tank C-104. Pumping was completed on March 10, 2010 (RPP-RPT-45845, <i>Completion of Pumpable Liquids Removal from 244-CR Vault</i>). The completion letter was sent to ORP on April 28, 2010 (Dunning 2010). Tank volumes except tank CR-001 are from RPP-RPT-24257, <i>244-CR Vault Liquid Level Assessment and Video Inspection Completion Report</i>. Following WRPS-PER-2012-0724, quarterly monitoring of Tank CR-001 was implemented in April 2013 by installation of an ENRAF monitoring device; the volume is derived from RPP-CALC-24219, <i>244-CR Vault Tank and Cell Volume Calculations</i>.</p>	Table 5-1
(71)	<p>Tank AZ-301 is an active part of the DST system.</p>	Table 5-1
(72)	<p>244-AR vault was interim-stabilized in 2003 (RPP-12051, <i>244-AR Vault Interim Stabilization Completion Report</i>). The waste volumes reported in Table 5-2 are taken from that report. The tanks and cell sumps in the 244-AR Vault are monitored quarterly for signs of intrusion.</p>	Table 5-1

HNF-EP-0182  
Revision 337

**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(74)	Records in the waste information data system indicate that Tank 244-UR-004 did not contain radioactive material. The tank was used to stage nitric acid to the other 244-UR vault tanks during the uranium recovery process in the 1950s.	Table 5-2
(75)	On August 1, 2002, a video surveillance at the 242-TA receiver vault revealed that catch tank TA-R1 was floating off its foundation due to liquid at a depth of approximately 10 ft in the vault. It was observed that associated piping was damaged. Approximately 7,000 gal of liquid had accumulated in the vault. Pumping the liquid from the vault and resealing the cover plate to prevent further intrusion were completed November 26, 2003. The remaining liquid volume in the vault was not reported (Occurrence Report RP-CHG-TANKFARM-2002-0083, "Video Surveillance Reveals Catch Tank TA-R1 Floating Off Of Its Foundation at 242-TA Vault").	Table 5-2
(76)	Video surveillance of 242-T-135 was prompted by the discovery of approximately 7,000 gal of water in the 242-TA receiver vault on August 1, 2002. There was no report of water present (Occurrence Report RP--CHG-TANKFARM-2002-0083).	Table 5-2
(77)	Removed from service on March 23, 2001 (Occurrence Report RP-CHG-TANKFARM-2001-0014, "Catch Tank 152-AX Was Identified as a Potential Leaking Tank").	Table 5-1
(79)	Tank AX-102 integrity status was changed from "assumed leaker" to "sound" per RPP-ASMT-42628, <i>Tank 241-AX-102 Integrity Assessment Report</i> .	Table 4-2
(81)	Tank AX-104 integrity status was changed from "assumed leaker" to "sound" per RPP-ASMT-57574, <i>Tank 241-AX-104 Integrity Assessment Report</i> .	Table 4-2
(82)	Partially filled with grout February 1991, determined to be an assumed leaker after leak tests. No surface level or intrusion readings obtainable. Tank S-304 replaced 241-S-302A.	Table 5-2
(83)	241-TX-302-B(R) replaced 241-TX-302B and a new 241-TX-302B later replaced 241-TX-302B(R).	Table 5-2
(84)	244-U-TK and 244-U-Sump were never placed in service. Per RPP-RPT-58156, "Tank 244-U was originally intended as the saltwell receiver for 241-U tank farm tanks. However the tank was bypassed and never received saltwell waste."	Table 5-2



**Table 6-1. Waste Tank Summary Report Endnotes (8 pages)**

No. <sup>a</sup>	Comment/Reference	Location
(85)	The following references provide additional information for the listed tanks: <ul style="list-style-type: none"> <li>Baumhardt, 1989: Tank B-101, B-103, B-105, B-107, B-110, B-111, B-112, B-203, B-204, BX-101, BX-102, BX-108, BX-110, BX-111, BY-105, BY-106, BY-107, C-101, C-203, S-104, SX-111, SX-112, SX-113, SX-114, T-103, T-106, T-107, T-109, TX-105, TX-107, TX-110, TX-113, TX-114, TX-115, TX-116, TX-117, TY-103, TY-104, TY-105, TY-106, U-101, U-104, U-110, and U-112</li> <li>Clark, 2012: Tank AY-102</li> <li>Groth, 1987: Tanks C-201, C-202, and C-204</li> <li>PNL-4688, 1983: Tanks A-104, BY-103, BY-108, and SX-107</li> <li>RHO-RE-SR-14, 1984: Tank B-201</li> <li>RPP-ASMT-46452, 2010: Tank C-105</li> <li>RPP-RPT-54964, 2014: Tank T-111</li> <li>WHC-MR-0300, 1992: Tank SX-108</li> <li>WHC-MR-0301, 1992: Tank SX-109</li> <li>WHC-MR-0302, 1992: Tank SX-115</li> <li>WHC-TANKFARM-1992-0073, 1992: Tank T-101</li> <li>WHC-TANKFARM-1994-0009, 1994: Tank T-111</li> </ul>	Table 4-2
(86)	See RPP-RPT-50799, 2015, <i>Suspect Water Intrusion in Single-Shell Tanks</i> , Revision 2, for basis for intrusion decision and intrusion rates. Tanks SX-102 and T-111 are only discussed in Appendix B of RPP-RPT-50799 since the videos in these two tanks were obtained for reasons other than intrusion investigation.	Table 4-3, Table 4-4
(87)	T-111 values do not include the volume reduction associated with the current exhauster operation on the tank. The tank T-111 volume will be updated following completion of exhauster operation.	Table 4-1
(88)	See RPP-RPT-58849, 2015, <i>Fiscal Year 2015 Visual Inspection Report for Single-Shell Tanks</i> , Revision 0, for basis for intrusion decision.	Table 4-4

<sup>a</sup> The following endnotes have been deleted from this report: 7, 36- 42, 61-62, 67, 73, 78, and 80. The original endnote numbering has been retained; deleted endnote numbers have been retired to maintain consistency with the numbering of the remaining endnotes.

DOE	= U.S. Department of Energy	SST	= single-shell tank
DST	= double-shell tank	TWINS	= Tank Waste Information Network System
Ecology	= Washington State Department of Ecology	WAC	= Washington Administrative Code
ORP	= U.S. Department of Energy, Office of River Protection		

HNF-EP-0182  
Revision 337

## 6.2 REFERENCES

- 24950-WTP-ICD-MG-019, 2013, *ICD 19 – Interface Control Document for Waste Feed*, Rev. 6, Bechtel National, Inc., Richland, Washington.
- Baumhardt, R. J., 1989, “Single Shell Tank Leak Volumes,” (Letter 8901832B R1 to R. E. Gerton, U.S. Department of Energy, Richland Operations Office, May 15), Westinghouse Hanford Company, Richland, Washington.
- Catlin, R. J., 1980, *Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford*, Office of Environmental Compliance and Review, U.S. Department of Energy, Washington, D.C.
- Clark, W. C., 2012, “Contract Number DE AC27 08RV1480 – Washington River Protection Solutions, LLC Tank 241-AY-102 Primary Tank Leak Integrity Change from Sound to Assumed Leaker, and Double-Shell Waste Tank Leak Integrity Definitions,” (Letter WRPS-1204634 to T. W. Fletcher, U.S. Department of Energy, Office of River Protection, November 13), Washington River Protection Solutions, LLC, Richland, Washington.
- DOE O 435.1, 2001, *Radioactive Waste Management*, Change 1 (Certified 2007), U.S. Department of Energy, Washington, D.C.
- Dunning, A. B., 2010, “Contract Number DE AC27 08RV14800 – Washington River Protection Solutions LLC Completion of Performance Based Incentive 1.5, Fee Bearing Milestone 1.5.1, Remove Liquids from the Secondary Containment of the 244-CR Vault – Request For Incremental Fee Approval,” (Letter WRPS-1000848 to S. E. Bechtol, U.S. Department of Energy, Office of River Protection, April 28), Washington River Protection Solutions, LLC, Richland, Washington.
- Ecology, EPA, and DOE, 1989, *Hanford Federal Facility Agreement and Consent Order – Tri-Party Agreement (TPA)*, as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.
- Fletcher, T. W., 2013a, “The U.S. Department of Energy, Office of River Protection (ORP) Submits the Retrieval Completion Certification and Report for Tank 241-C-104,” (Letter 13-TF-0018 to J. A. Hedges, Washington State Department of Ecology, March 21), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Fletcher, T. W., 2013b, “The U.S. Department of Energy, Office of River Protection (ORP) Submits the Retrieval Completion Certification and Report for Tank 241-C-108,” (Letter 13-TF-0025 to J. A. Hedges, Washington State Department of Ecology, May 1), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Groth, D. R., 1987, “Liquid Level Losses in Tanks 241-C-201, 202, and 204,” (Internal Memorandum 65950-87-517 to R. J. Baumhardt, July 1), Westinghouse Hanford Company, Richland, Washington.
- HNF-3233, 1998, *Re-Analysis of SX Farm Leak Histories with the Historical Leak Model Rev. 1 (HLMr1)*, Rev. 1, Washington River Protection Solutions, LLC, Richland, Washington.

HNF-EP-0182

Revision 337

- HNF-3484, 2009, *Double-Shell Tank Emergency Pumping Guide*, Rev. 10, Washington River Protection Solutions, LLC, Richland, Washington.
- HNF-5985, 2000, *ER-311 Flammable Gas Response and Findings*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- HNF-EP-0182, 2005, *Waste Tank Summary Report for Month Ending September 30, 2005*, Rev. 210, CH2M HILL Hanford Group, Inc., Richland, Washington.
- HNF-SD-RE-TI-178, 2005, *Single Shell Tank Interim Stabilization Record*, Rev. 9, CH2M HILL Hanford Group, Inc., Richland, Washington.
- HNF-SD-WM-OCD-015, 2014, *Tank Farms Waste Transfer Compatibility Program*, Rev. 38, Washington River Protection Solutions, LLC, Richland, Washington.
- Jensen, L., and Merrill, J. A., 1989, "Estimation of Single Shell Tank Leak Volumes," (Internal Letter 12710-89-042 to R. E. Raymond, March 28), Westinghouse Hanford Company, Richland, Washington.
- Lyon, J. J., 2005, "Tank Farm Vadose Zone Contamination Volume Estimates, RPP-23405, Revision 1, released September 6, 2005; Waste Tank Summary Report for August and September 2005, HNF-EP-0182, Revisions 209 and 210," (Letter to R. J. Schepens, U.S. Department of Energy, Office of River Protection, December 22), Washington State Department of Ecology, Richland, Washington.
- Olinger, S. J., 2007a, "Submittal of Retrieval Data Report (RDR) for Single-Shell Tank 241-C-103, RPP-RPT-33060, Revision 0," (Letter 07-TPD-026 to J. Hedges, Washington State Department of Ecology, May 21), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Olinger, S. J., 2007b, "Submittal of Demonstration Retrieval Data Report (RDR) for Single-Shell Tank 241-C-204, RPP-RPT-34062, Revision 0," (Letter 07-TPD-043 to J. Hedges, Washington State Department of Ecology, August 9), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Olinger, S. J., 2007c, "Submittal of Retrieval Data Report (RDR) for Single-Shell Tank 241-S-112, RPP-RPT-35112, Revision 0," (Letter 07-TPD-066 to J. Hedges, Washington State Department of Ecology, December 21), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Olinger, S. J., 2007d, "Submittal of Notification of Completion of Liquid Removal from Catch Tank 241-ER-311," (Letter 07-TOD-026 to J. Hedges, Washington State Department of Ecology, March 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- OSD-T-151-00007, 2015, *Operating Specifications for the Double-Shell Storage Tanks*, Rev. 16, Washington River Protection Solutions, LLC, Richland, Washington.
- PNL-4688, 1983, *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site*, Washington, Pacific Northwest Laboratory, Richland, Washington.
- RHO-RE-SR-14, 1984, *Waste Status Summary*, Rockwell Hanford Operations, Richland, Washington.



HNF-EP-0182  
Revision 337

- RP-CHG-TANKFARM-2001-0014, 2001, "Catch Tank 152-AX Was Identified as a Potential Leaking Tank," CH2M HILL Hanford Group, Inc., Richland, Washington.
- RP-CHG-TANKFARM-2002-0083, 2002, "Video Surveillance Reveals Catch Tank TA-R1 Floating Off Of Its Foundation at 242-TA Vault," CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-12051, 2003, *244-AR Vault Interim Stabilization Completion Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13019, 2003, *Determination of Hanford Waste Tank Volumes*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-20577, 2007, *Stage II Retrieval Data Report for Single Shell Tank 241-C-106*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-23405, 2005, *Tank Farm Vadose Zone Contamination Volume Estimates*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-29441, 2006, *Post-Retrieval Waste Volume Determination for Single Shell Tank 241-C-201*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-32681, 2013, *Process to Assess Tank Farm Leaks in Support of Retrieval and Closure Planning*, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-33741, 2007, *Tank 241-EW-151 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-35057, 2007, *Tank 240-S-302 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-38219, 2008, *Tank 241-C-110 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-39155, 2008, *Tank 241-C-111 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-ASMT-42278, 2009, *Tank 241-A-103 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-42628, 2014, *Tank 241-AX-102 Integrity Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-46452, 2010, *Tank 241-C-105 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-47140, 2010, *Tank 241-SX-110 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-48143, 2011, *Tank 241-SX-104 Leak Assessment Completion Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ASMT-53793, 2012, *Tank 241-AY-102 Leak Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.

HNF-EP-0182

Revision 337

- RPP-ASMT-57574, 2014, *Tank 241-AX-104 Integrity Assessment Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-24219, 2005, *244 CR Vault Tank and Cell Volume Calculations*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-CALC-33163, 2007, *Tank Waste Volume and Level Calculations in Dome Space for 241-AP Tank Farm Up to 460 Inches*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-CALC-52903, 2014, *Retrieval Performance of Tank 241-C-107 Using the Bulk Mobile Arm Retrieval System*, Rev. 3, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-54266, 2013, *Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-108*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-54284, 2013, *Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-104*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-54759, 2013, *Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-019*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-56399, 2013, *Post-Hard Heel Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-110*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-56434, 2013, *Post-Retrieval Camera/CAD Modeling System Waste Volume Estimate for Tank 241-C-101*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-CALC-56856, 2014, *Estimated Waste Volume Remaining in Single-Shell Tank 241-C-112 after Hard Heel Retrieval*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ENV-33418, 2012, *Hanford C Farm Leak Assessments Report*, Rev. 2A, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ENV-37956, 2014, *Hanford 241-A/AX Farm Leak Inventory Assessment Report*, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-ENV-39658, 2010, *Hanford SX-Farm Leak Assessments Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-PLAN-55112, 2012, *September 2012 Single-Shell Tank Waste Level Increase Evaluation Plan*, Rev. 1, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-PLAN-55113, 2013, *March 2013 Single Shell Tank Waste Level Decrease Evaluation Plan*, Rev. 1, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-24257, 2005, *244-CR Vault Liquid Level Assessment and Video Inspection Completion Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.

HNF-EP-0182  
Revision 337

- RPP-RPT-26475, 2008, *Retrieval Data Report for Single Shell Tank 241-C-203*, Rev. 1A, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-29095, 2006, *Retrieval Data Report for Single Shell Tank 241-C-202*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-29163, 2006, *Tank 241-ER-311 Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-29711, 2006, *Tank 241-UX-302A Leak Assessment Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-31779, 2006, *241-UX-302A Catch Tank Liquid Mitigation Completion Report*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-33060, 2007, *Retrieval Data Report for Single Shell Tank 241-C-103*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-34062, 2007, *Retrieval Data Report for Single Shell Tank 241-C-204*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RRP-RPT-35112, 2007, *Retrieval Data Report for Single Shell Tank 241-S-112*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-RPT-42296, 2010, *Hanford TY-Farm Leak Assessments Report*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-42789, 2009, *Completion of Removal of Pumpable Liquid From 241-UX-302A*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-45147, *Derivation of Best-Basis Inventory for Tank 241-C-108 as of January 1, 2016*, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-45845, 2010, *Completion of Pumpable Liquids Removal from 244-CR Vault*, Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-46616, *Derivation of Best-Basis Inventory for Tank 241-C-104 as of January 1, 2016*, Washington River Protection Solutions, LLC, Richland, Washington. RPP-RPT-50799, 2015, *Suspect Water Intrusion in Single-Shell Tanks*, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-52516, 2015, *Derivation of Best-Basis Inventory For Tank 241-C-112 as of March 3, 2015*, Rev. 3, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-54964, 2014, *Evaluation of Tank 241-T-111 Level Data and In Tank Video Inspection*, Rev. 2, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-57458, 2015, *Derivation of Best-Basis Inventory for Tank 241-C-102 as of October 1, 2015*, Rev. 4, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-58156, 2014, *Basis for Miscellaneous Underground Storage Tanks and Special Surveillance Facilities Waste Volumes Published in HNF-EP-0182 Revision 320 "Waste Tank Summary Report for Month Ending August 31, 2014,"* Rev. 0, Washington River Protection Solutions, LLC, Richland, Washington.



HNF-EP-0182

Revision 337

- RPP-RPT-58788, 2015, *Retrieval Completion Certification Report For Tank C-102, Rev. 0*, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-58849, 2015, *Fiscal Year 2015 Visual Inspection Report for Single-Shell Tanks*, Revision 0, Washington River Protection Solutions, LLC, Richland, Washington.
- RPP-RPT-59004, 2015, *Post Retrieval Camera. CAD Modeling System Waste Volume Estimate for Tank 241-C-102*, Washington River Protection Solutions, LLC, Richland, Washington.
- Sax, S. M., 2010, "Contract Number DE AC27 08RV14800 – Washington River Protection Solutions, LLC Transmittal of the Single-Shell Tank Interim Stabilization Evaluation Report for Tank 241-S-102," (Letter WRPS-1000772 R1 to S. L. Charboneau, U.S. Department of Energy, Office of River Protection, June 1), Washington River Protection Solutions, LLC, Richland, Washington.
- Schepens, R. J., 2006a, "Process for Reaching Agreement on Tank Farm Vadose Zone Leak Loss Estimate," (Letter 06-TPD-059 to J. Hedges, Washington State Department of Ecology, August 18), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006b, "Submittal of the Demonstration Retrieval Data Report (RDR) for Single-Shell Tank 241-C-201, RPP-RPT-30181, Revision 0A," (Letter 06-TPD-071 to J. Hedges, Washington State Department of Ecology, November 2), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006c, "Submittal of Demonstration Retrieval Data Report (RDR) for Single-Shell Tank C-202, RPP-RPT-29095, Rev. 0," (Letter 06-TPD-051 to J. Hedges, Washington State Department of Ecology, July 31), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006d, "Submittal of Demonstration Retrieval Data Report (RDR) for Single-Shell Tank C-203, RPP-RPT-26475, Rev. 1," (Letter 06-TPD-005 to J. Hedges, Washington State Department of Ecology, January 18), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Schepens, R. J., 2006e, "Notification of Completion of Pumping Liquids from Catch Tank 244-UX302A and Start of Evaporation of Liquid from Catch Tank 241-ER-311," (Letter 06-TOD-090 to J. Hedges, Washington State Department of Ecology, November 1), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- SD-WM-SAR-006, 1986, *Single-Shell Tank Isolation Safety Analysis Report*, Rev. 2, Rockwell Hanford Operations, Richland, Washington.
- Smith, K. W., 2013, "The U.S. Department of Energy, Office of River Protection (ORP) Submits the Retrieval Completion Certification and Report for Tank 241-C-109," (Letter 13-TF-0037 to J. A. Hedges, Washington State Department of Ecology, June 4), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014a, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-110," (Letter 14-TF-0007 to J. A. Hedges, Washington State Department of Ecology, January 29), U.S. Department of Energy, Office of River Protection, Richland, Washington.

HNF-EP-0182  
Revision 337

- Smith, K. W., 2014b, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-101," (Letter 14-TF-0113 to J. A. Hedges, Washington State Department of Ecology, September 24), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014c, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-107," (Letter 14-TF-0114 to J. A. Hedges, Washington State Department of Ecology, September 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2014d, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification and Report for Tank 241-C-112," (Letter 14-TF-0115 to J. A. Hedges, Washington State Department of Ecology, September 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Smith, K. W., 2015, "The U.S. Department of Energy, Office of River Protection Submits the Retrieval Completion Certification Report for Tank 241-C-102," (Letter 15-TF-0116 to J. A. Hedges, Washington State Department of Ecology, November 30), U.S. Department of Energy, Office of River Protection, Richland, Washington.
- TFC-ENG-CHEM-D-42, 2013, "Tank Leak Assessment Process," Rev. B-7, Washington River Protections Solutions, LLC, Richland, Washington.
- TFC-WO-11-5930 WCN-2, 2012, "241-UX-302A Pumping Liquid out of Tank," Washington River Protections Solutions, LLC, Richland, Washington.
- WAC 173-303-070, "Dangerous Waste Regulations," Section 70, "Designation of Dangerous Waste," *Washington Administrative Code*, as amended, Washington State Department of Ecology, Olympia, Washington.
- WHC-EP-0410, 1991, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0132, 1990, *A History of the 200 Area Tank Farms*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0264, 1991, *Tank 241-A-105 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0300, 1992, *Tank 241-SX-108 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington. WHC-MR-0301, 1992, *Tank 241-SX-109 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington.
- WHC-MR-0302, 1992, *Tank 241-SX-115 Leak Assessment*, Westinghouse Hanford Company, Richland, Washington.
- WHC-SD-EN-TI-185, 1993, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single Shell Tanks 241-C-105 and 241-C-106*, Rev. 0-A, Westinghouse Hanford Company, Richland, Washington.
- WHC-SD-WM-SAR-040, 1991, *Safety Analysis Report for the 204-AR Waste Unloading Facility*, Rev. 1, Westinghouse Hanford Company, Richland, Washington.

HNF-EP-0182

Revision 337

WHC-SD-WM-TI-356, 1988, *Waste Storage and Leak Detection Criteria*, Rev. 0, Westinghouse Hanford Company, Richland, Washington.

WHC-TANKFARM-1992-0073, 1992, "Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing," Westinghouse Hanford Company, Richland, Washington.

WHC-TANKFARM-1994-0009, 1994, "Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker," Westinghouse Hanford Company, Richland, Washington.



## APPENDIX A – GLOSSARY

Term (abbreviation)	Definition or expansion
<b>Administratively Interim Stabilized</b>	A tank that meets interim stabilization criteria without the use of a jet pump, typically tanks that contained small waste inventories or experienced high rates of evaporation.
<b>Annulus</b>	The space between the inner and outer shells in DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where ENRAF gauges are installed. The ENRAF gauges are the primary means of leak detection for all DSTs. The leak detection system may not be replaced by, but may be supplemented by, the operation of an annulus ventilation system CAM.
<b>Annulus Pump Pit</b>	The DST concrete pit used for the pump and piping required to empty waste from the annular space between the primary tank and secondary tank in the event of a leak from the primary tank. The annulus pump pit is connected to the DST center pump pit via installed underground piping; from the center pump pit, the waste will be returned to the primary tank or transferred to another DST. Primary tank emergency pumping using the annulus pump pit is described in HNF-3484. <sup>a</sup>
<b>Assumed Leaker<sup>b</sup></b>	The integrity classification of a waste storage tank for which surveillance data indicates a loss of liquid to the environment attributed to a breach of integrity.
<b>Assumed Leaker – Primary Tank<sup>b</sup></b>	The integrity classification of a DST for which surveillance data indicate a loss of liquid attributed to a breach of primary tank integrity.
<b>Characterization</b>	An understanding of the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.
<b>Closure</b>	Final closure of the operable units (tank farms) is defined as regulatory approval of completion of closure actions and commencement of post-closure actions. Per the <i>Hanford Federal Facility Agreement and Consent Order</i> <sup>c</sup> Change Control Form, Change Number M-45-02-03, all units located within the boundary of each tank farm will be closed in accordance with WAC 173-303-610. <sup>d</sup>
<b>Continuous Air Monitor (CAM)</b>	The CAM passes a small portion of the DST annulus space exhaust airstream through filter paper that is continuously monitored for radiation. If airborne radioactive contamination is present in the annulus, it will collect on the filter paper. When the radiation count rate exceeds the preset alarm threshold, local and remote alarms are triggered.
<b>Drainable Interstitial Liquid (DIL)</b>	The DIL is calculated based on saltcake and sludge volumes and calculated porosity values. Interstitial liquid is the liquid that fills the interstitial spaces of the solid waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of DIL. Interstitial liquid that is not held in place by capillary forces will, therefore, migrate or move with gravity.
<b>Drywells</b>	Drywells are open bottom 6-in. or 8-in. steel casings placed vertically around an SST perimeter, and extending between 75 ft and 200 ft below-grade. Historically, the drywells were monitored with gross gamma radiation logging tools as part of a secondary leak monitoring system. In some cases, neutron probes were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994; a program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically. The terms “drywells” and “boreholes” are used interchangeably.



HNF-EP-0182

Revision 337

Term (abbreviation)	Definition or expansion
<b>ENRAF 854 ATG Level Detector</b>	The ENRAF gauge, fabricated by Honeywell, determines waste level by detecting variations in the weight of a displacer lowered to the tank waste surface. ENRAF gauges transmit digital level data to the TMACS via an ENRAF computer interface unit. The computer interface unit allows fully remote communication with the gauge, minimizing tank farm entry.
<b>Interim Stabilization</b>	A tank that contains less than 50 kgal of DIL and less than 5 kgal of supernatant is interim-stabilized. If a jet pump was used to achieve interim stabilization, the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gal/min before interim stabilization criteria are met.
<b>Interstitial Liquid Level</b>	The height of the residual liquid occupying the interstitial spaces in the solid waste heel of an interim stabilized SST.
<b>Intrusion Prevention</b>	The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump), in accordance with SD-WM-SAR-006. <sup>c</sup>
<b>Jet Pump</b>	The centrifugal pump and jet assembly used to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-ft elevation rise. Pumping rates vary from 0.05 to about 4 gal/min.
<b>Laterals</b>	Laterals are horizontal drywells positioned 8 to 10 ft under SSTs, three per tank, to detect radionuclides in the soil that could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are located only in A and SX Farms. There are currently no functioning laterals and no plan to prepare them for use.
<b>Leak Detection Pits</b>	Enclosed sumps collect drainage from the concrete foundations of the four AX Farm SSTs and the 28 DSTs. In the event of a breach of containment of the SST or the DST secondary tank, the leak detection pit drain system collects leakage from the drain channels cast in the foundation and directs it to the leak detection pit where it can be pumped to a nearby sound DST. A leak is detected by an increase in the leak detection pit liquid level. Only DST leak detection pits are monitored for increases.
<b>Liquid Observation Well (LOW)</b>	In-tank LOWs are used for monitoring the interstitial liquid level in SSTs. The wells are usually constructed of fiberglass or TEFZEL <sup>f</sup> F-reinforced epoxy-polyester resin. A few LOWs are constructed of steel. Gamma and neutron probes are used to monitor changes in the interstitial liquid level and can indicate intrusions or leakage by increases or decreases in the interstitial liquid level. OSD-T-151-00031, <sup>g</sup> identifies which LOWs are designated as the primary monitoring device in the SSTs. All of the SST LOWs are monitored quarterly. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.
<b>Modified Sluicing</b>	Modified sluicing sprays supernatant or water onto the surface of SST waste to mobilize it to a slurry and direct it to the inlet of the slurry pump. The pump transfers the slurry to a DST where the slurry is allowed to settle out. The clarified liquid is pumped back to the SST sluicers for reuse. The method is referred to as <i>modified sluicing</i> to differentiate it from historical <i>past-practice sluicing</i> that used significantly higher sluice pressures and flow rates, and greater volumes.
<b>Nominal Volume of Remaining Waste</b>	Nominal volume of remaining waste is the best estimate of residual volume following retrieval. Retrieval data reports also provide the 95 percent upper confidence level volume as the bounding estimate of remaining waste.



HNF-EP-0182  
Revision 337

Term (abbreviation)	Definition or expansion
<b>Primary Tank</b>	The metal inner tank of the DST structure that holds the radioactive liquid waste. The primary tank is constructed of high strength, stress-relieved steel to minimize the potential for cracking, and is monitored for corrosion and leakage once placed in service.
<b>Retrieval</b>	Retrieval is the process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Per OSD-T-151-00031, <sup>8</sup> a tank is officially in "retrieval status" if one of two conditions is met: (1) waste has been physically removed from the tank by retrieval operations, or (2) preparations for retrieval operations are directly responsible for rendering the leak or intrusion monitoring instrument "out-of-service."
<b>Saltcake</b>	Saltcake is soluble salts in waste storage tanks formed by the evaporation of liquid waste from nuclear reactor fuels reprocessing, and is characterized by high porosity, interstitial liquid drainability, and crystalline texture.
<b>Saltwell Screen</b>	The saltwell screen is a 10-in. diameter casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into a 12-in. tank riser located in the pump pit. The stainless steel screen portion of the system extends through the tank waste to near the bottom of the tank.
<b>Secondary Tank</b>	The metal outer tank of the DST structure that holds radioactive liquid waste in the event of a breach in the primary tank. The annular space between the primary and secondary tanks is equipped with continuous leak detection to provide early warning of a primary tank leak and an access pit for insertion of emergency pumping equipment.
<b>Sludge</b>	Sludge is the insoluble hydrated metal oxides and fission products in waste storage tanks from nuclear reactor fuels reprocessing, and is characterized by low porosity, reduced interstitial liquid drainability, and mud-like texture.
<b>Sound<sup>a</sup></b>	The integrity classification of a waste storage tank for which surveillance data indicates no loss of liquid attributed to a breach of integrity.
<b>Supernatant</b>	Supernatant is the liquid above the solids or in large liquid pools in waste storage tanks.
<b>Surface Levels</b>	The surface level in all waste storage tanks is monitored by manual tape probes or ENRAF gauges, and recorded and transmitted via the surveillance analysis computer system.
<b>Thermocouple Tree</b>	A thermocouple tree is installed in tanks to collect temperature data for process control and for determining compliance with temperature-based operating specifications. The thermocouple tree is typically a closed, 2-in. diameter steel pipe extending to within 6-in. of the tank bottom. Eighteen or more thermocouples are placed inside the pipe, spaced at vertical intervals of 6-in. to about 24-in., depending on the thermocouple design and intended purpose. Thermocouple leads terminate above-grade in a terminal box monitored locally or by TMACS. SST thermocouple trees that fail are not replaced.
<b>Total Waste</b>	For purposes of this document, total waste is solids volume (sludge and saltcake, including liquids) plus supernatant.
<b>Weight Factor</b>	The weight factor is an indirect method of determining the tank liquid level by measuring the air pressure necessary to overcome the hydrostatic head in an open-end vertical steel pipe terminated about 2-in. above the tank floor. The "uncorrected weight factor" is the difference between the hydrostatic head pressure in the pipe and the air pressure in the tank headspace, expressed in inches of water. To eliminate the liquid density bias that affects the uncorrected weight factor measurement, a second vertical pipe is located in the liquid, terminated 10-in. above the first pipe. The difference in hydrostatic head between the two pipes is converted to specific gravity (i.e., ratio of the liquid density to water density); the uncorrected weight factor divided by the specific gravity yields the "corrected weight factor," which is the true liquid height in the tank.



HNF-EP-0182

Revision 337

Term (abbreviation)	Definition or expansion
<b>Zip Cord</b>	The zip cord is a primitive liquid level detection device consisting of a calibrated insulated wire pair to which electrodes have been attached. To make the measurement, the zip cord is slowly lowered to a point where the liquid surface is contacted by the electrodes. The liquid level reading is recorded when the portable direct current meter connected between the wire leads registers zero ohm resistance.
<sup>a</sup>	RHO-RE-SR-14, 1984, <i>Waste Status Summary October 1984</i> , Rockwell Hanford Operations, Richland, Washington.
<sup>b</sup>	Clark, W. C., 2012, "Contract Number DE AC27 08RV1480 – Washington River Protection Solutions, LLC Tank 241-AY-102 Primary Tank Leak Integrity Change from Sound to Assumed Leaker, and Double-Shell Waste Tank Leak Integrity Definitions," (Letter WRPS-1204634 to T. W. Fletcher, U.S. Department of Energy, Office of River Protection, November 13), Washington River Protection Solutions, LLC, Richland, Washington.
<sup>c</sup>	Ecology, EPA, and DOE, 1989, <i>Hanford Federal Facility Agreement and Consent Order – Tri-Party Agreement (TPA)</i> , as amended, Washington State Department of Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy, Olympia, Washington.
<sup>d</sup>	WAC 173-303-610, "Dangerous Waste Regulations," Section 610, "Closure and Post-Closure," <i>Washington Administrative Code</i> , as amended, Washington State Department of Ecology, Olympia, Washington.
<sup>e</sup>	SD-WM-SAR-006, 1986, <i>Single-Shell Tank Isolation Safety Analysis Report</i> , Rev. 2, Rockwell Hanford Operations, Richland, Washington.
<sup>f</sup>	TEFZEL is a trademark of E. I. du Pont de Nemours & Company, Wilmington, Delaware.
<sup>g</sup>	OSD-T-151-00031, 2014, <i>Operating Specifications for Tank Farm Leak Detection and Single-Shell Tank Intrusion Detection</i> , Rev. 6, Washington River Protection Solutions, LLC, Richland, Washington.
CAM	= continuous air monitor.
DIL	= drainable interstitial liquid.
DST	= double-shell tank.
LOW	= liquid observation well.
SST	= single-shell tank.
TMACS	= tank monitor and control system.
WAC	= Washington Administrative Code.

HNF-EP-0182  
Revision 337**DISTRIBUTION LIST****OFFSITE – USA**

<b>Number of copies</b>	<b>Address</b>
2 hard copies	<b>Congress of the United States</b> U.S. Senate 717 Hart Senate Building Washington D.C. 20510 Senator Ron Wyden  U.S. House of Representatives 1641 Longworth House Office Building Washington D. C. 20515 Congressman Dan Newhouse, 4th District
1 electronic only	<b>U.S. Department of Energy-Headquarters</b> Elizabeth Connell Elizabeth.Connell@hq.doe.gov
1 electronic only	Christy King-Gilmore Christy.king-gilmore@hq.doe.gov
1 electronic only	Nicholas P. Machara nicholas.machara@em.doe.gov
1 electronic only	Jim Poppiti james.poppiti@em.doe.gov
1 electronic only	Theodore A. Wyka Theodore.wyka@em.doe.gov
1 electronic only	Kenneth Picha kenneth.picha@em.doe.gov
1 electronic only	<b>U.S. Department of Justice</b> Kenneth Amaditz Kenneth.Amaditz@usdoj.gov
1 hard copy	<b>Washington State Department of Health</b> Office of Radiation Protection 309 Bradley Boulevard, Suite 201 Richland, WA, 99352
1 hard copy	<b>Oregon Department of Energy</b> Nuclear Safety Division 625 Marion St. NE Salem, OR 97301-3737 Dirk Dunning, P.E.
1 electronic only	<b>U.S. Defense Nuclear Facilities Safety Board</b> Carter Shuffler CarterS@dnfsb.gov

HNF-EP-0182  
Revision 337

**TRI-CITIES**

<b>Number of copies</b>	<b>Address</b>
1 electronic copy	<b>Meier Architecture Engineering</b> Anthony G. Cockbain agcockbain@meierinc.com
1 hard copy	<b>Tri-City Herald</b> Annette Carey 333 West Canal Dr. Kennewick, WA 99336
1 hard copy	Robert J. Cash 114 Somerset St. Richland, WA 99354-1966
1 hard copy	Richard Welty 409 S. 41 <sup>st</sup> Ave W. Richland, WA 99353-5005



HNF-EP-0182  
Revision 337

## ONSITE

Number of copies	Address	Mail Stop
<b>Government Accountability Office</b>		
1 electronic only	N. K. Kintner-Meyer	A1-80
1 electronic only	J. T. Larson	A1-80
<b>U.S. Defense Nuclear Facilities Safety Board</b>		
1 electronic only	P. K. Fox	S7-04
1 electronic only	D. M. Gutowski	S7-04
<b>U.S. Environmental Protection Agency</b>		
1 hard copy	D. A. Faulk	A3-46
<b>U.S. Department of Energy</b>		
1 electronic only	S. M. Braswell	H6-60
1 electronic only	S. J. Beehler	H6-60
1 electronic only	M. E. Burandt	H6-60
1 electronic only	J. E. Cheadle	H6-60
1 electronic only	J. A. Dowell	H6-60
1 hard copy	T. W. Fletcher	H6-60
1 electronic only	R. L. Frink	H6-60
1 electronic only	J. F. Grindstaff	H6-60
1 electronic only	B. A. Harkins	H6-60
1 electronic only	P. R. Hernandez	H6-60
1 electronic only	K. L. Higgins	H6-60
1 electronic only	D. H. Irby	H6-60
1 electronic only	J. M. Johnson	H6-60
1 electronic only	C. J. Kemp	H6-60
1 electronic only	R. J. Koll	H6-60
1 electronic only	Y. M. Levardi	H6-60
1 hard copy	S. S. Lowe	H0-57
1 electronic only	D. L. Noyes	H6-60
1 electronic only	S. H. Pfaff	H6-60
1 electronic only	R. V. Bushey	H6-60
1 electronic only	K. W. Smith	H6-60
1 electronic only	B. J. Stickney	H6-60
1 electronic only	W. B. Scott	H6-60
1 electronic only	J. Shuen	H6-60
1 electronic only	D. M. Smith	H6-60
1 electronic only	D. M. Stewart	H6-60
1 electronic only	P. J. Swann	H6-60
1 hard copy	G. D. Trenchard	H6-60
1 electronic only	R. J. Valle	H6-60
1 hard copy	Reading Room (P.H. McCormick)	H2-53
<b>Office of the Inspector General</b>		
1 electronic only	M. C. Howard	B8-27
1 electronic only	L. A. Hughes	B8-27
1 electronic only	A. S. Nielsen	B8-27
1 electronic only	T. M. O'Byrne	B8-27
1 electronic only	K. E. Otero	B8-28
1 electronic only	J. M. Pesek	B8-27
1 electronic only	L. J. Poppe	B8-27
1 electronic only	R. L. Stout	B8-27
1 electronic only	D. M. Thomas	B8-27
1 electronic only	S. Won	B8-27

HNF-EP-0182  
Revision 337

### Washington River Protection Solutions, LLC

Number of copies	Address	Mail Stop
1 electronic only	D. G. Baide	R2-53
1 electronic only	H. L. Baune	H0-51
1 electronic only	K. R. Beaulaurier	S5-08
1 electronic only	J. J. Brown	S5-08
1 electronic only	J. L. Castleberry	S7-02
1 electronic only	T. M. Crane	T4-70
1 electronic only	M. S. Cuttlers	S5-08
1 electronic only	J. Duarte	S5-08
1 electronic only	B. K. Everett	S5-08
1 electronic only	M. L. Farner	K8-41
1 electronic only	K. D. Frisby	S5-63
1 electronic only	J. E. Geary	S7-02
1 electronic only	R. E. Gregory	S7-68
1 electronic only	M. L. Hendrickson	H0-51
1 electronic only	J. N. Holloway	H3-22
1 electronic only	D. J. Houghton	R1-02
1 electronic only	B. A. Johnson	S5-13
1 electronic only	K. E. Sterling	S5-08
1 electronic only	N. W. Kirch	H0-51
1 electronic only	T. J. Knaff	S5-08
1 electronic only	M. A. Lindholm	H3-21
1 electronic only	M. T. Lutz	S5-08
1 electronic only	A. G. Miskho	H0-55
2 hard copies	R. J. Moore	S3-95
1 electronic only	M.S. Ornstein	H6-60
1 electronic only	A.H. Purvis	T4-70
1 electronic only	J. S. Rodriguez	S5-08
1 electronic only	R. T. Roxburgh	H3-22
1 hard copy	T. L. Sams	H0-51
1 electronic only	D. H. Shuford	H0-51
1 electronic only	D. K. Smith	S5-01
1 electronic only	T. S. Synoground	S5-08
1 electronic only	M. F. Tavelli	R2-58
1 elec. & 1 hard copy	A. M. Templeton	H0-51
1 electronic only	L. E. Thompson	H0-56
1 electronic only	J. A. Voogd	R1-51
1 hard copy	WFO Shift Office	S5-08
1 hard copy	Environmental Data Mgmt Center	H6-08

### CH2M Hill Plateau Remediation Contractor

Number of copies	Address	Mail Stop
1 electronic only	G. S. Thomas	R3-50

### Washington State Department of Ecology

Number of copies	Address	Mail Stop
1 electronic only	J. M. Alzheimer	H0-57
1 hard copy	J. J. Lyon	H0-57
1 hard copy	N. H. Uziemblo	H0-57
1 electronic only	K. J. Wold	H0-57
1 hard copy	Library	H0-57